



SIEVE ANALYSIS PALMBEACH_05_NAVD88.GPJ FL DEP ROSS.GDT 5/10/07

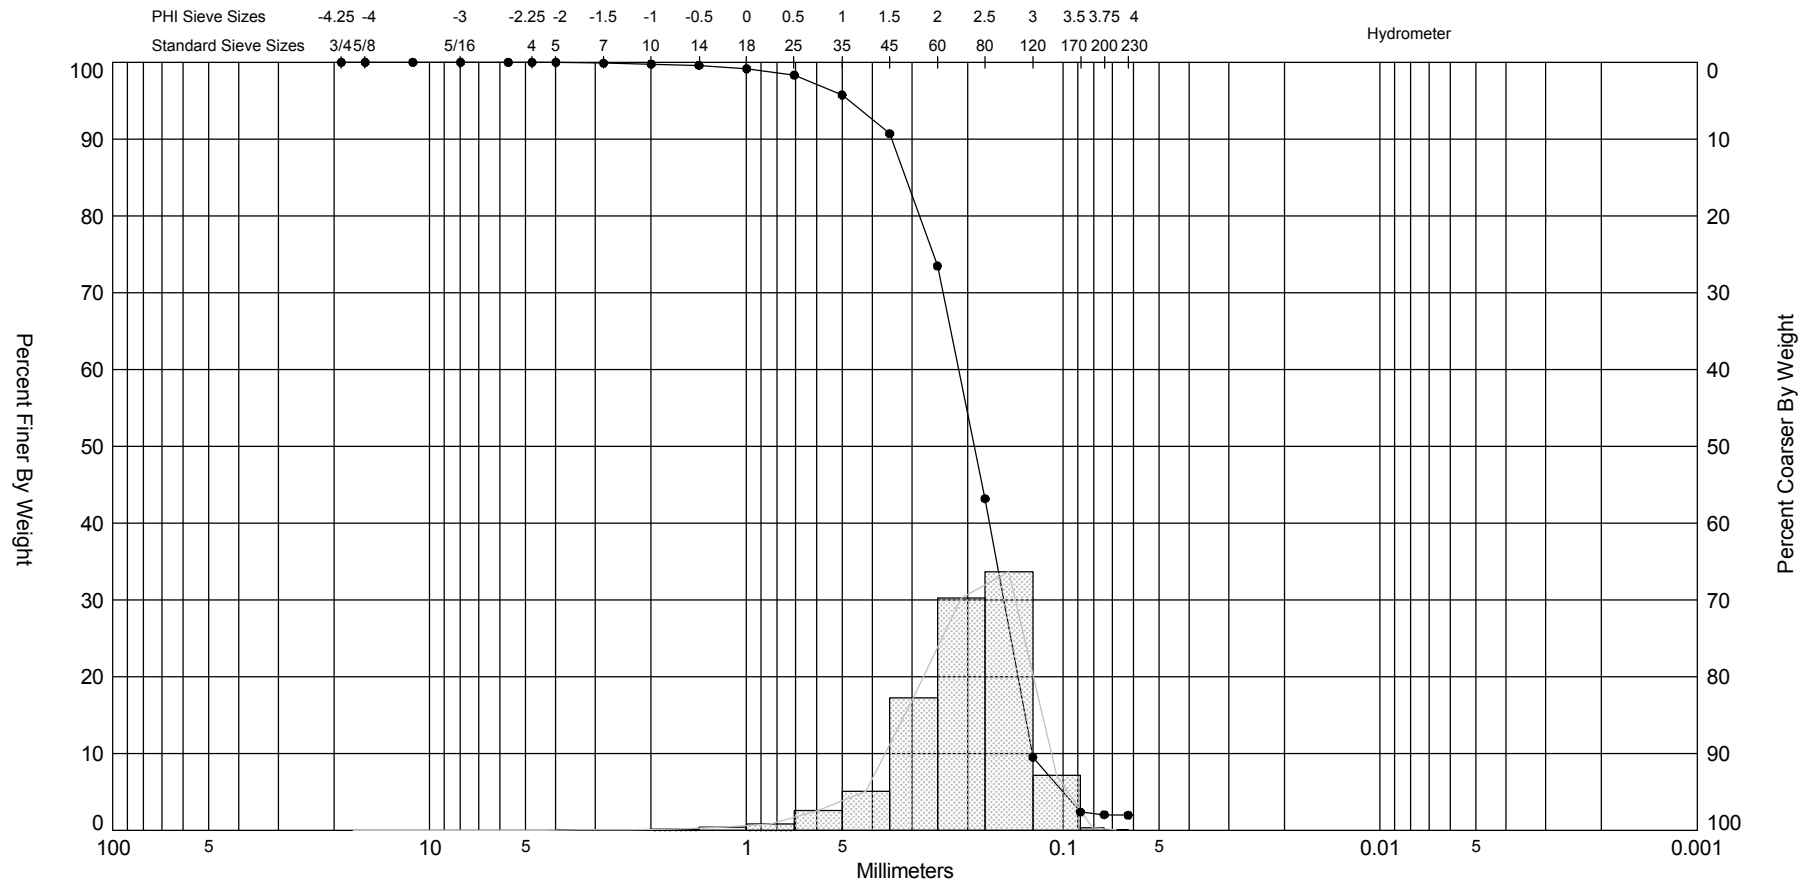

Gravel		Sand			Silt and Clay
Coarse	Fine	Coarse	Medium	Fine	

Sample	Symbol	Elev. (ft)	USCS	% Fines	% Organics	% Carbonates	Median	Mean	Skew	Kurt	Sort	Sample Information	
PBVC-05-10 #7	—●—	-34.8	SP	#200 - 2.04 #230 - 1.96		50.00	2.39	2.28	-1.34	6.82	0.66	Project Name:	Reach 8 Geotechnical Investigation
Comments:												Analysis Date:	03-16-05
Depths and elevations based on measured values												Analyzed By:	CPE
						Coastal Planning & Engineering 2481 NW Boca Raton Blvd, Boca Raton FL 33431 ph (561) 391-8102 fax (561) 391-9116						Easting (X, ft):	972,852
												Northing (Y, ft):	833,882
												Horizontal System:	NAD 1983
												Vertical System:	NAVD 88