



SIEVE ANALYSIS: SINGER ISLAND.GPJ FL DEP ROSS.GDT 9/23/05

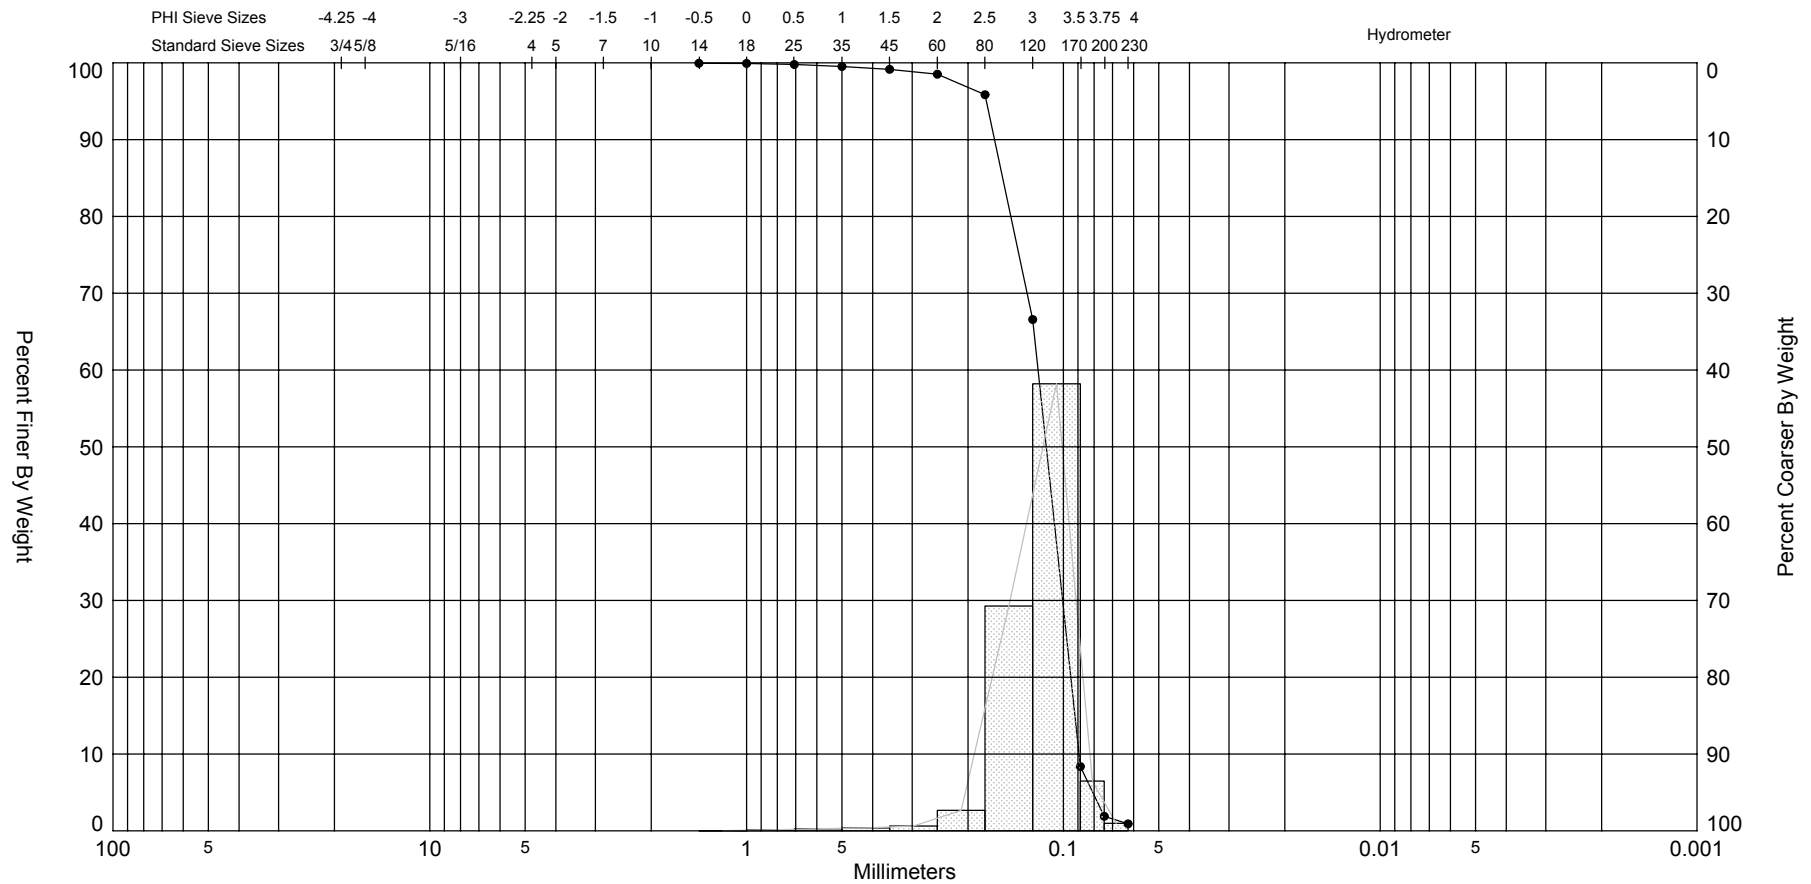

Gravel		Sand			Silt and Clay	
Coarse	Fine	Coarse	Medium	Fine		

Sample	Symbol	Elev. (ft)	USCS	% Fines	% Organics	% Carbonates	Median	Mean	Skew	Kurt	Sort	Sample Information	
SI-05-78 #1.0	—●—	-50.9	SP	#200 - 1.89 #230 - 0.91		19.39	3.14	3.08	-2.1	13.24	0.38	Project Name:	Singer Island 2005
Comments:												Analysis Date:	09-06-05
Depths and elevations based on measured values												Analyzed By:	SEA Inc.
						Scientific Environmental Applications 5575 Willoughby Drive Melbourne, FL 32934 ph 321 254-2708 fax 321 254-2708						Easting (X, ft):	974,123
												Northing (Y, ft):	904,661
												Horizontal System:	NAD 1983
												Vertical System:	NGVD 29


SIEVE ANALYSIS: SINGER ISLAND.GPJ FL DEP ROSS.GDT 9/23/05

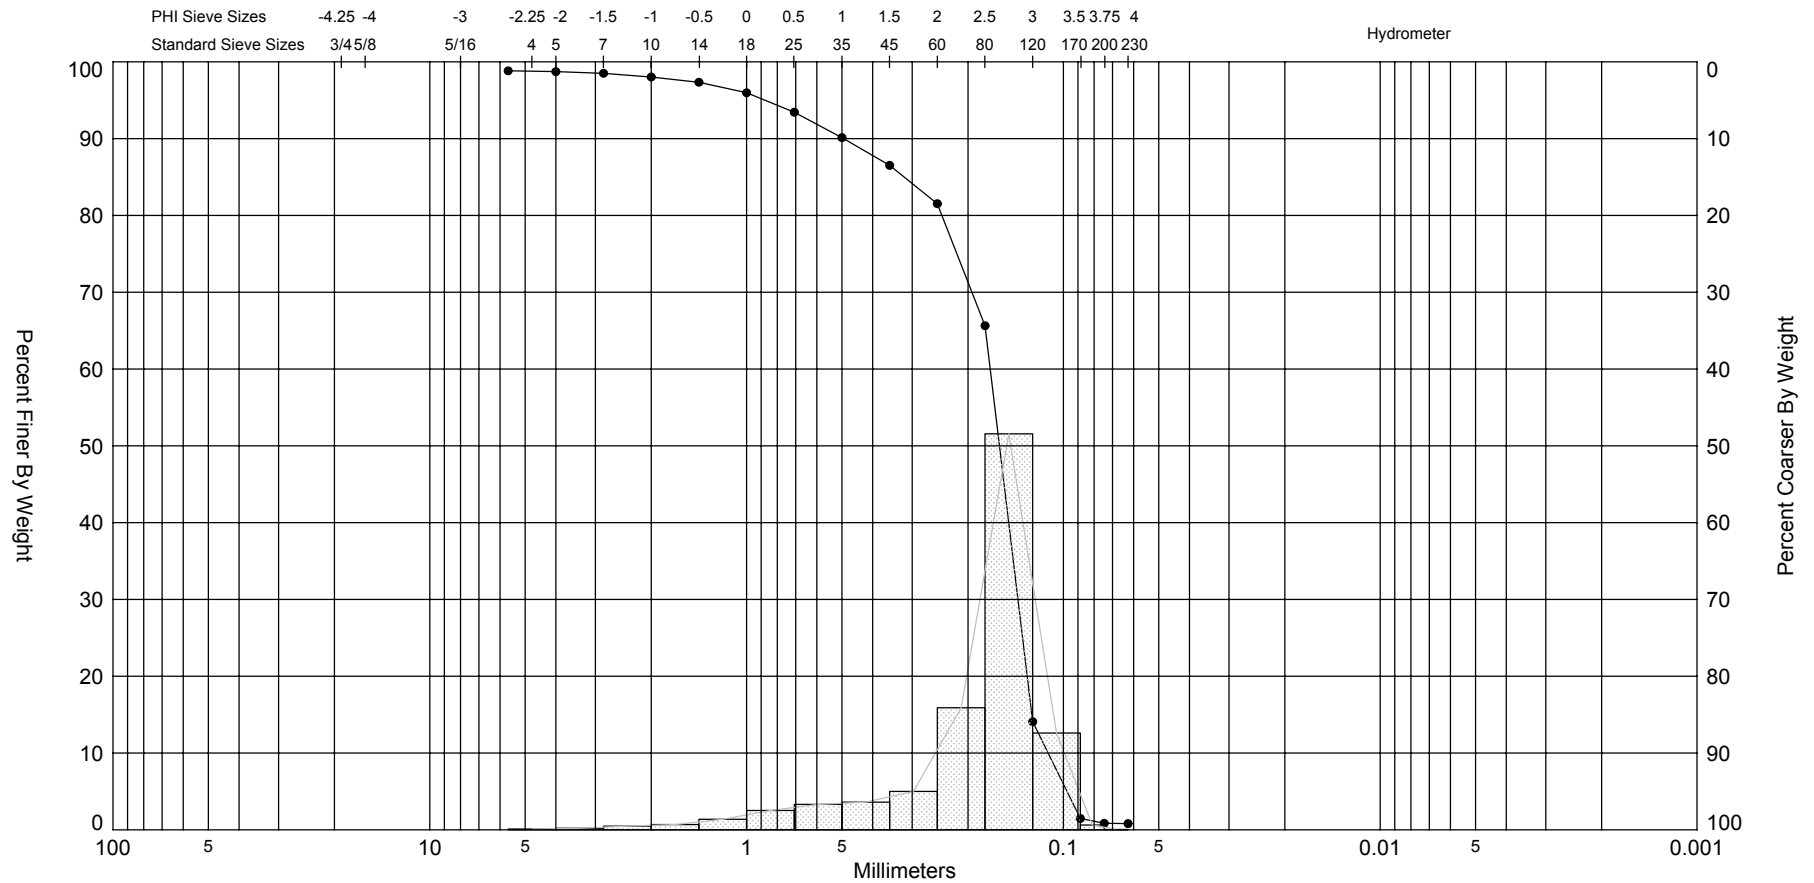

Gravel		Sand			Silt and Clay	
Coarse	Fine	Coarse	Medium	Fine		

Sample	Symbol	Elev. (ft)	USCS	% Fines	% Organics	% Carbonates	Median	Mean	Skew	Kurt	Sort	Sample Information	
SI-05-78 #5.0	—●—	-54.9	SP	#200 - 0.85 #230 - 0.81		45.89	2.65	2.34	-1.87	7.29	0.86	Project Name:	Singer Island 2005
Comments:												Analysis Date:	09-06-05
Depths and elevations based on measured values												Analyzed By:	SEA Inc.
						Scientific Environmental Applications 5575 Willoughby Drive Melbourne, FL 32934 ph 321 254-2708 fax 321 254-2708						Easting (X, ft):	974,123
												Northing (Y, ft):	904,661
												Horizontal System:	NAD 1983
												Vertical System:	NGVD 29


SIEVE ANALYSIS: SINGER ISLAND.GPJ FL DEP ROSS.GDT 9/23/05

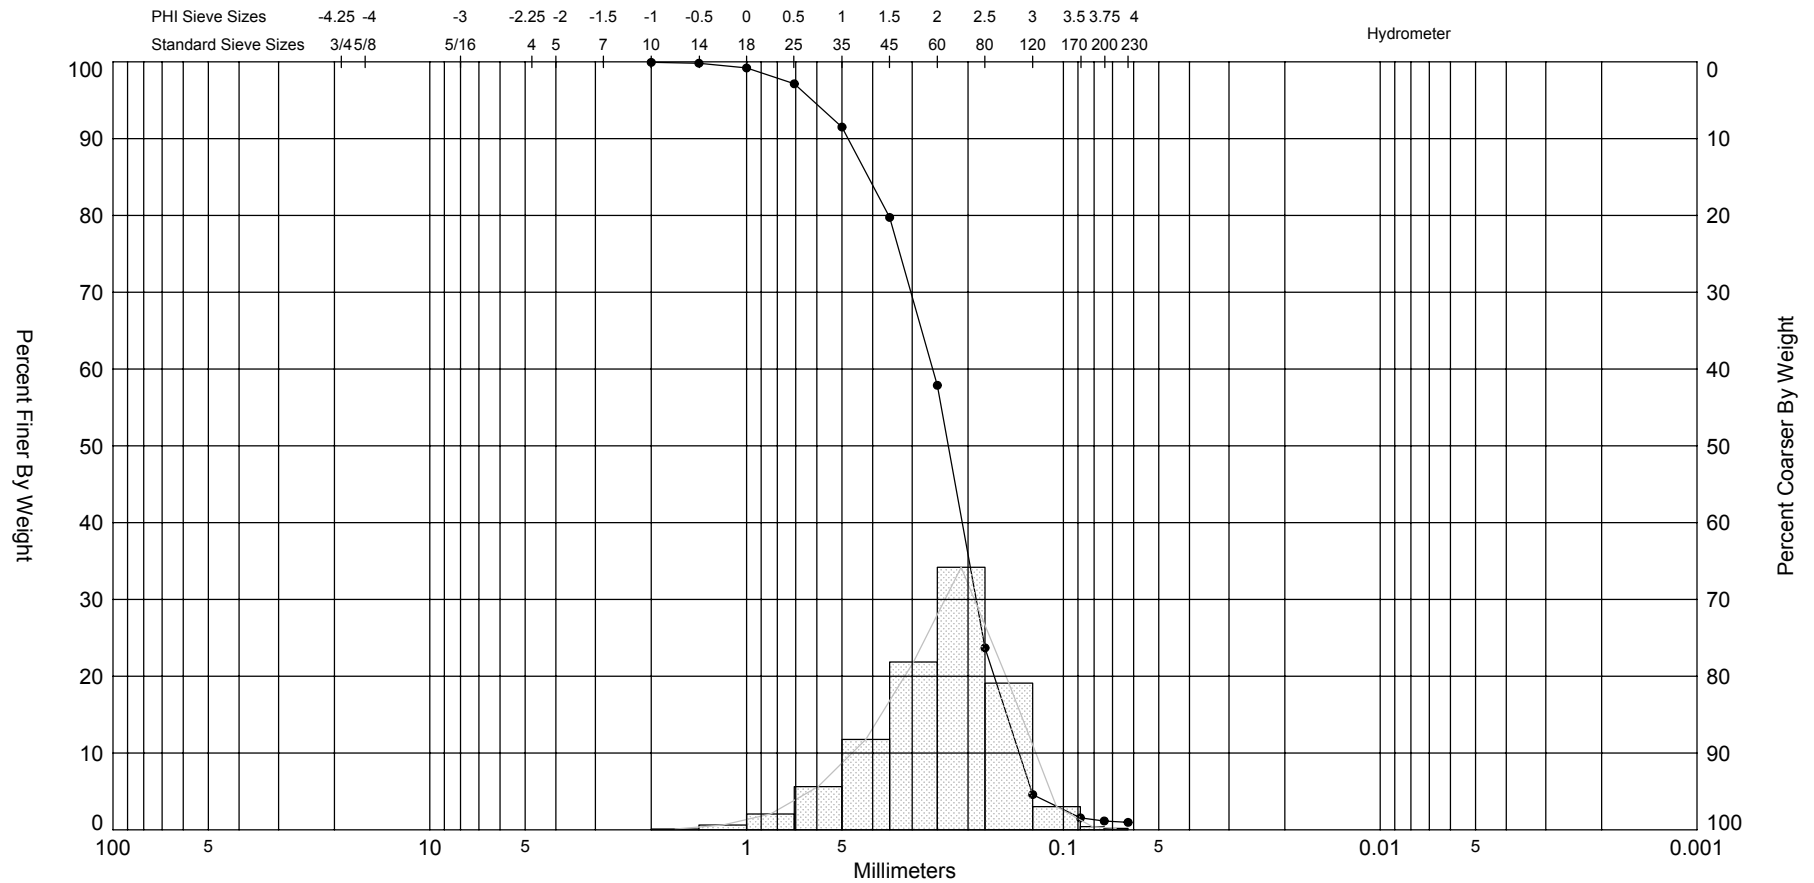

Gravel		Sand			Silt and Clay
Coarse	Fine	Coarse	Medium	Fine	

Sample	Symbol	Elev. (ft)	USCS	% Fines	% Organics	% Carbonates	Median	Mean	Skew	Kurt	Sort	Sample Information	
SI-05-78 #10.0	—●—	-59.9	SP	#200 - 1.15 #230 - 0.97		67.03	2.12	2.01	-0.64	3.61	0.68	Project Name:	Singer Island 2005
Comments:												Analysis Date:	09-06-05
Depths and elevations based on measured values												Analyzed By:	SEA Inc.
						Scientific Environmental Applications 5575 Willoughby Drive Melbourne, FL 32934 ph 321 254-2708 fax 321 254-2708						Easting (X, ft):	974,123
												Northing (Y, ft):	904,661
												Horizontal System:	NAD 1983
												Vertical System:	NGVD 29


SIEVE ANALYSIS: SINGER ISLAND.GPJ FL DEP ROSS.GDT 9/23/05

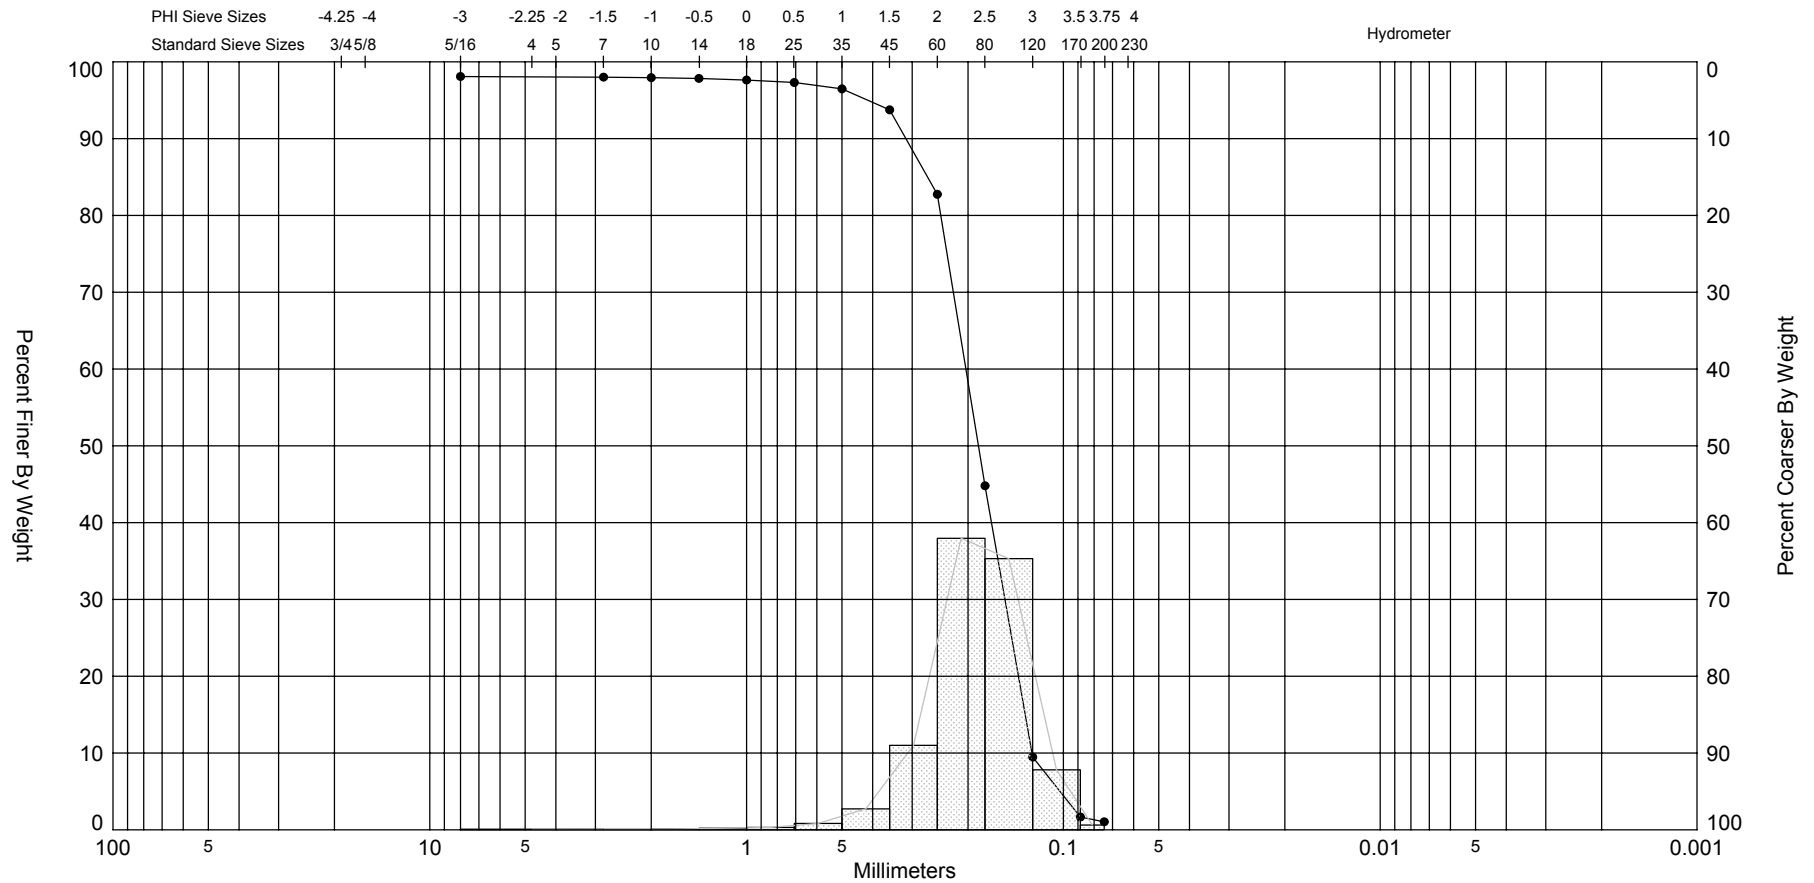

Gravel		Sand			Silt and Clay	
Coarse	Fine	Coarse	Medium	Fine		

Sample	Symbol	Elev. (ft)	USCS	% Fines	% Organics	% Carbonates	Median	Mean	Skew	Kurt	Sort	Sample Information	
SI-05-78 #15.0	—●—	-64.9	SP	#200 - 1.05		62.46	2.43	2.28	-0.89	9.29	0.55	Project Name:	Singer Island 2005
Comments:												Analysis Date:	09-06-05
Depths and elevations based on measured values												Analyzed By:	SEA Inc.
						Scientific Environmental Applications 5575 Willoughby Drive Melbourne, FL 32934 ph 321 254-2708 fax 321 254-2708						Easting (X, ft):	974,123
												Northing (Y, ft):	904,661
												Horizontal System:	NAD 1983
												Vertical System:	NGVD 29

SIEVE ANALYSIS: SINGER ISLAND.GPJ FL DEP ROSS.GDT 9/23/05

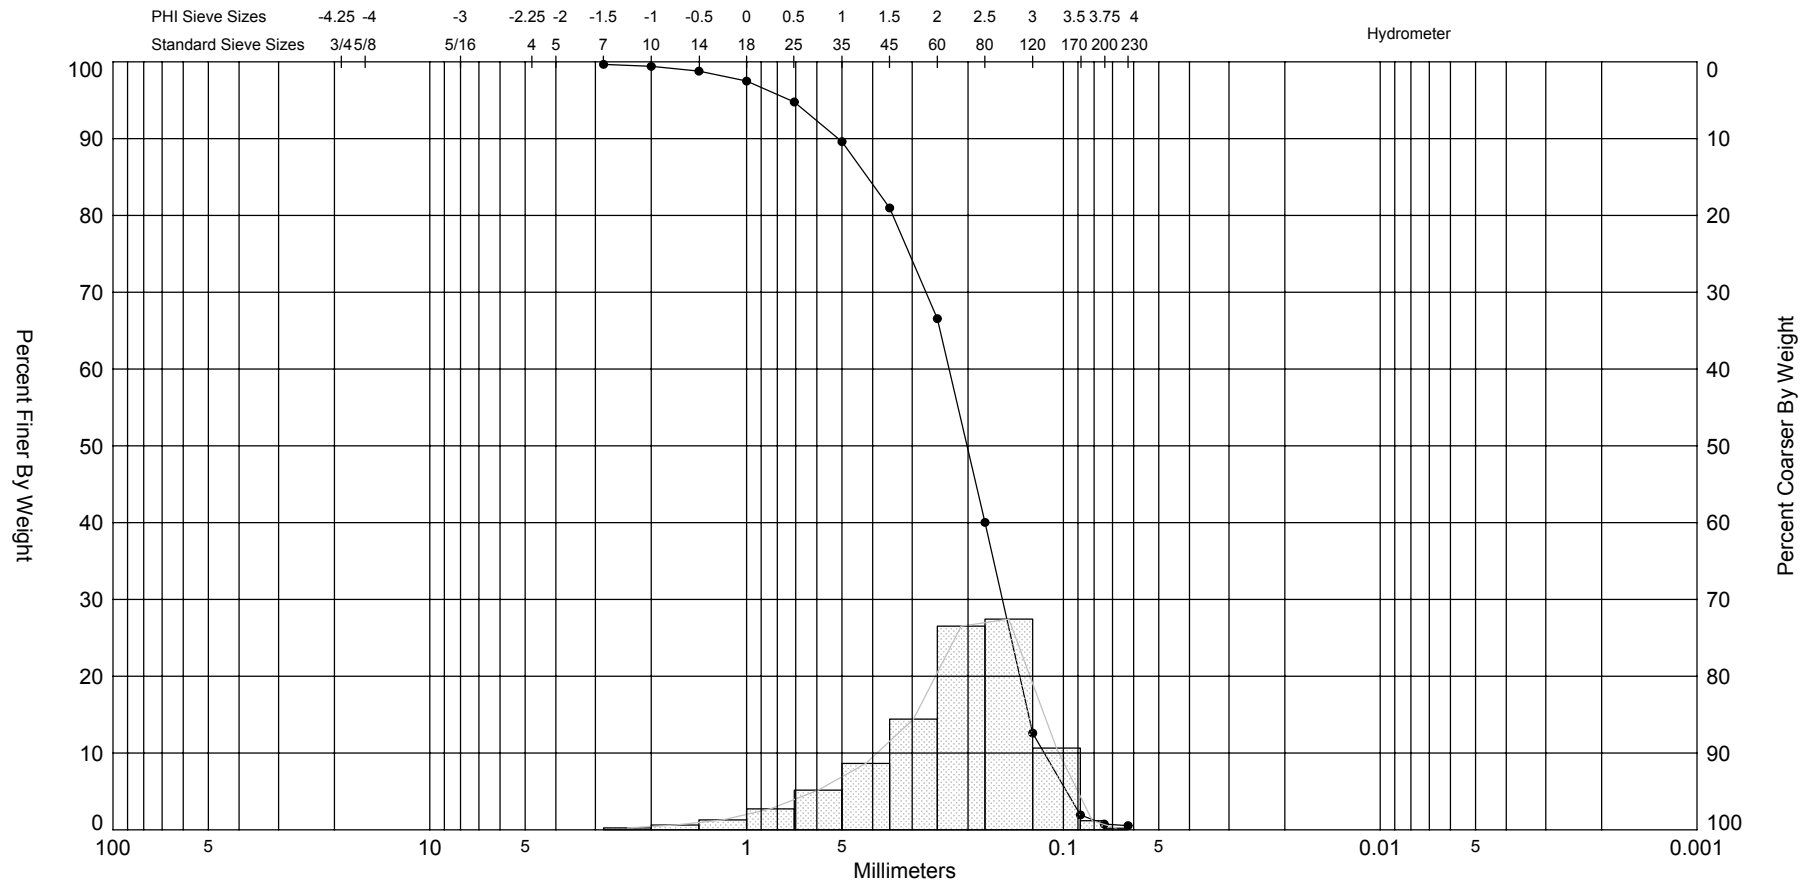

Gravel		Sand			Silt and Clay
Coarse	Fine	Coarse	Medium	Fine	

Sample	Symbol	Elev. (ft)	USCS	% Fines	% Organics	% Carbonates	Median	Mean	Skew	Kurt	Sort	Sample Information	
SI-05-78 #Comp	—●—	-66.9	SP	#200 - 0.75 #230 - 0.55		60.25	2.31	2.15	-0.97	4.11	0.85	Project Name:	Singer Island 2005
Comments:												Analysis Date:	09-06-05
Depths and elevations based on measured values												Analyzed By:	SEA Inc.
						Scientific Environmental Applications						Easting (X, ft):	974,123
						5575 Willoughby Drive						Northing (Y, ft):	904,661
						Melbourne, FL 32934						Horizontal System:	NAD 1983
						ph 321 254-2708						Vertical System:	NGVD 29
						fax 321 254-2708							