



SIEVE ANALYSIS: SINGER_IS.GPJ FL DEP ROSS.GDT 4/28/08

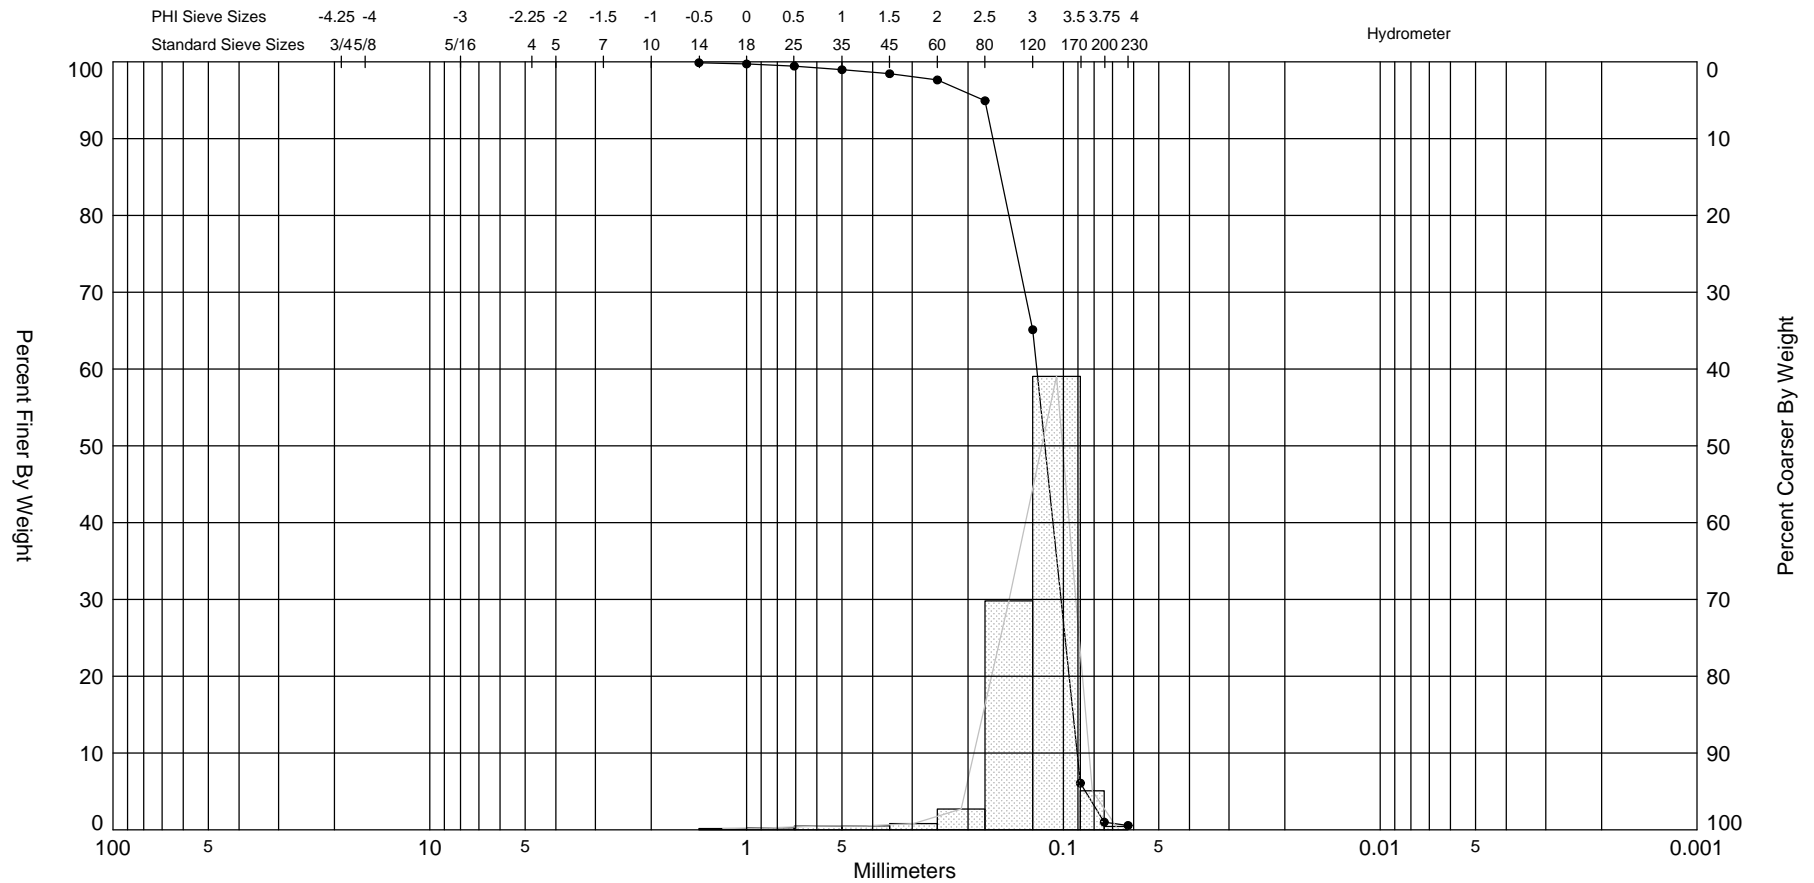


Gravel		Sand			Silt and Clay	
Coarse	Fine	Coarse	Medium	Fine		

Sample	Symbol	Elev. (ft)	USCS	% Fines	% Organics	% Carbonates	Median	Mean	Skew	Kurt	Sort	Sample Information	
SI04-1 #1.0	—●—	-29.0	SP	#200 - 1.00 #230 - 0.57		20.38	3.13	3.05	-2.9	17.57	0.43	Project Name:	Palm Beach County Vibracore 2004
Comments:												Analysis Date:	07-01-04
Depths and elevations based on measured values												Analyzed By:	SEA Inc
						Scientific Environmental Applications 5575 Willoughby Drive Melbourne, FL 32934 ph 321 254-2708 fax 321 254-2708						Easting (ft):	971,748
												Northing (ft):	907,751
												Horizontal System:	NAD 1983
												Vertical System:	NAVD 88

SIEVE ANALYSIS: SINGER_IS.GPJ FL DEP ROSS.GDT 4/28/08

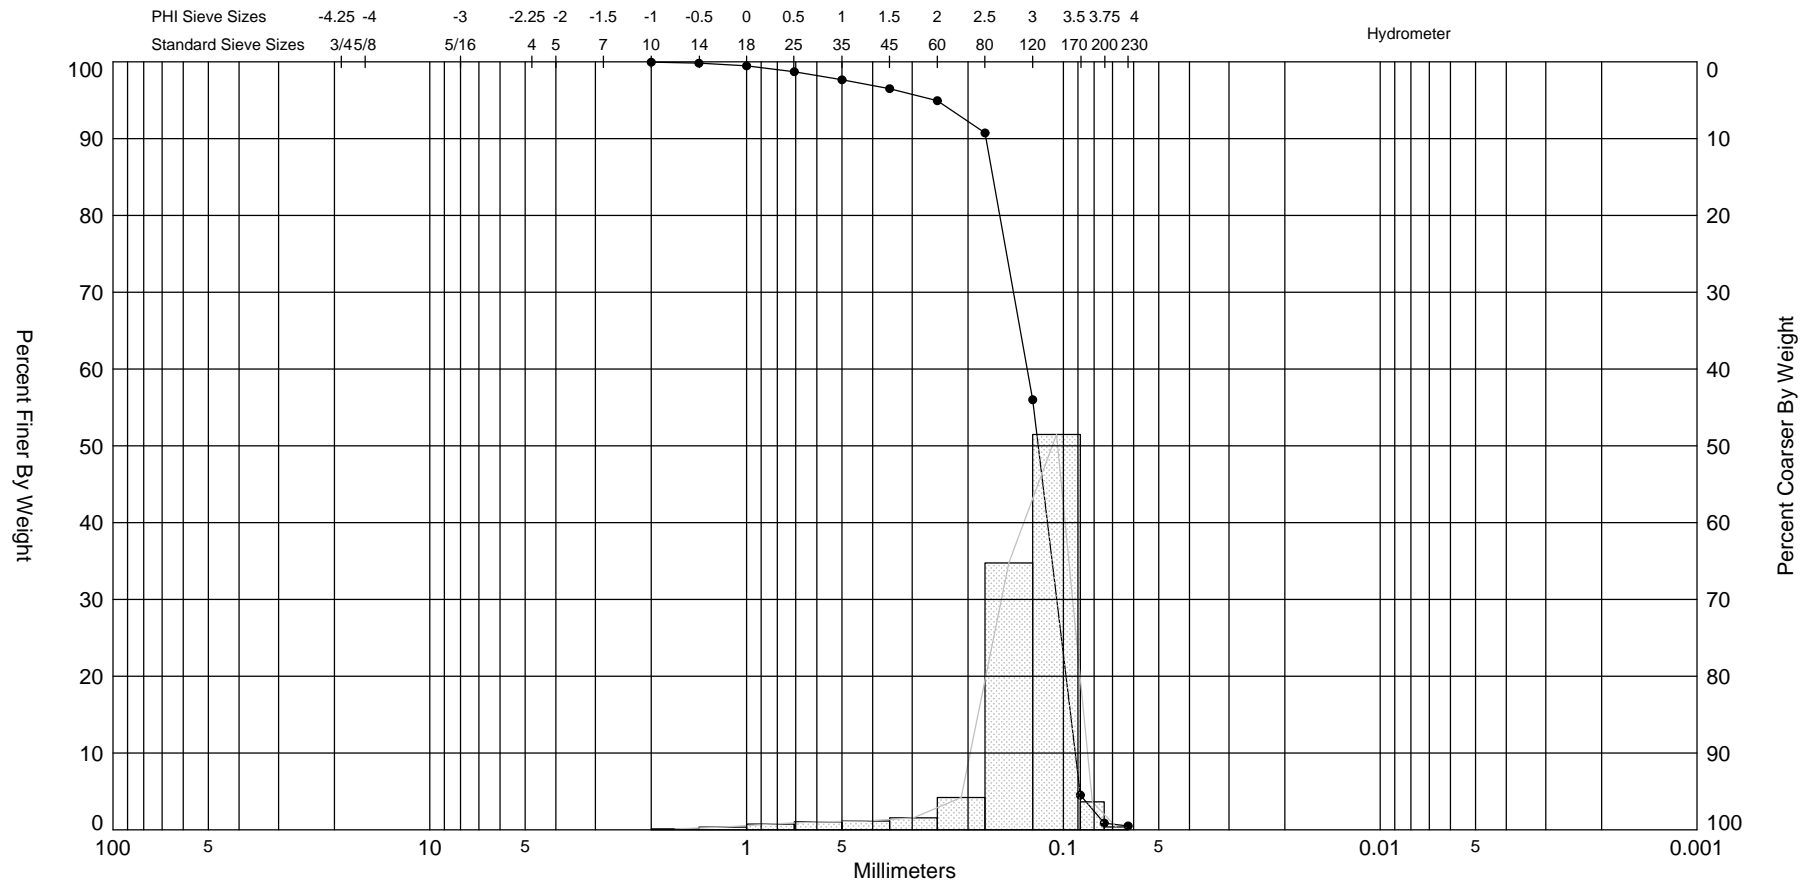

SIEVE ANALYSIS: SINGER_IS.GPJ FL DEP ROSS.GDT 4/28/08

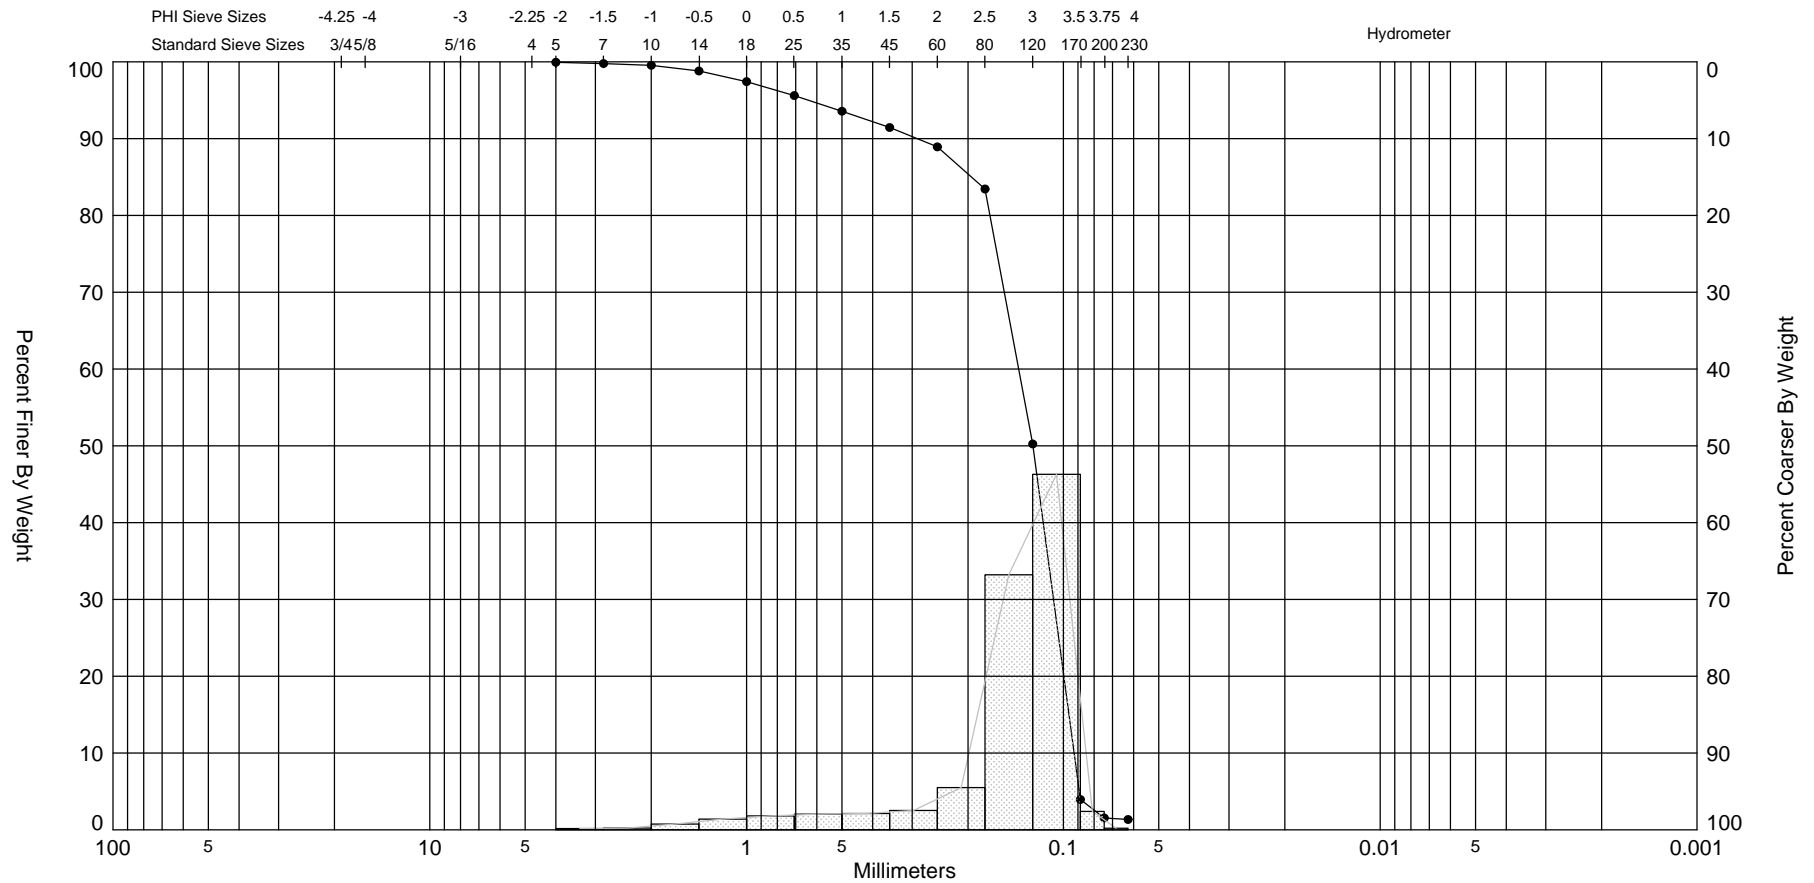

Gravel		Sand			Silt and Clay	
Coarse	Fine	Coarse	Medium	Fine		

Sample	Symbol	Elev. (ft)	USCS	% Fines	% Organics	% Carbonates	Median	Mean	Skew	Kurt	Sort	Sample Information	
SI04-1 #14.0	—●—	-42.0	SP	#200 - 1.55 #230 - 1.35		50.35	3	2.75	-2.46	9.39	0.84	Project Name:	Palm Beach County Vibracore 2004
Comments:												Analysis Date:	07-01-04
Depths and elevations based on measured values												Analyzed By:	SEA Inc.
						Scientific Environmental Applications 5575 Willoughby Drive Melbourne, FL 32934 ph 321 254-2708 fax 321 254-2708						Easting (ft):	971,748
												Northing (ft):	907,751
												Horizontal System:	NAD 1983
												Vertical System:	NAVD 88

SIEVE ANALYSIS: SINGER_IS.GPJ FL DEP ROSS.GDT 4/28/08

