



SIEVE ANALYSIS: SINGER ISLAND.GPJ FL DEP ROSS.GDT 9/23/05

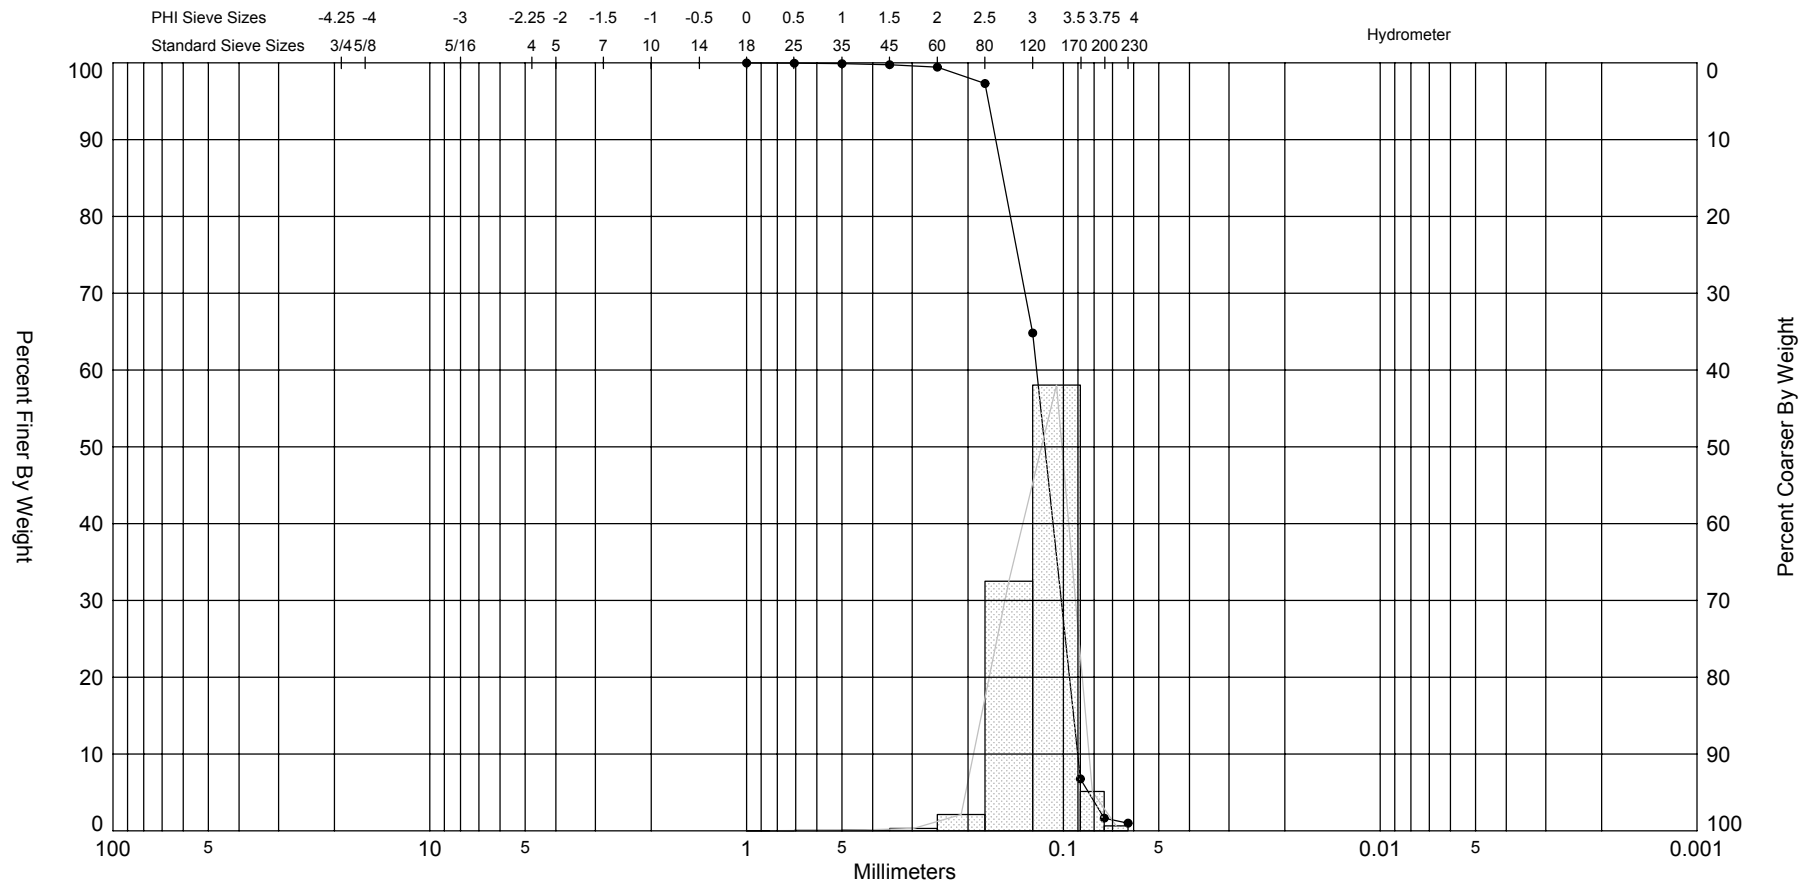

Gravel		Sand			Silt and Clay	
Coarse	Fine	Coarse	Medium	Fine		

Sample	Symbol	Elev. (ft)	USCS	% Fines	% Organics	% Carbonates	Median	Mean	Skew	Kurt	Sort	Sample Information	
SI-05-77 #1.0	—●—	-44.8	SP	#200 - 1.65 #230 - 1.00		18.35	3.13	3.08	-1.17	7.77	0.32	Project Name:	Singer Island 2005
Comments:												Analysis Date:	09-03-05
Depths and elevations based on measured values												Analyzed By:	SEA Inc.
						Scientific Environmental Applications 5575 Willoughby Drive Melbourne, FL 32934 ph 321 254-2708 fax 321 254-2708						Easting (X, ft):	973,688
												Northing (Y, ft):	905,367
												Horizontal System:	NAD 1983
												Vertical System:	NGVD 29


SIEVE ANALYSIS: SINGER ISLAND.GPJ FL DEP ROSS.GDT 9/23/05

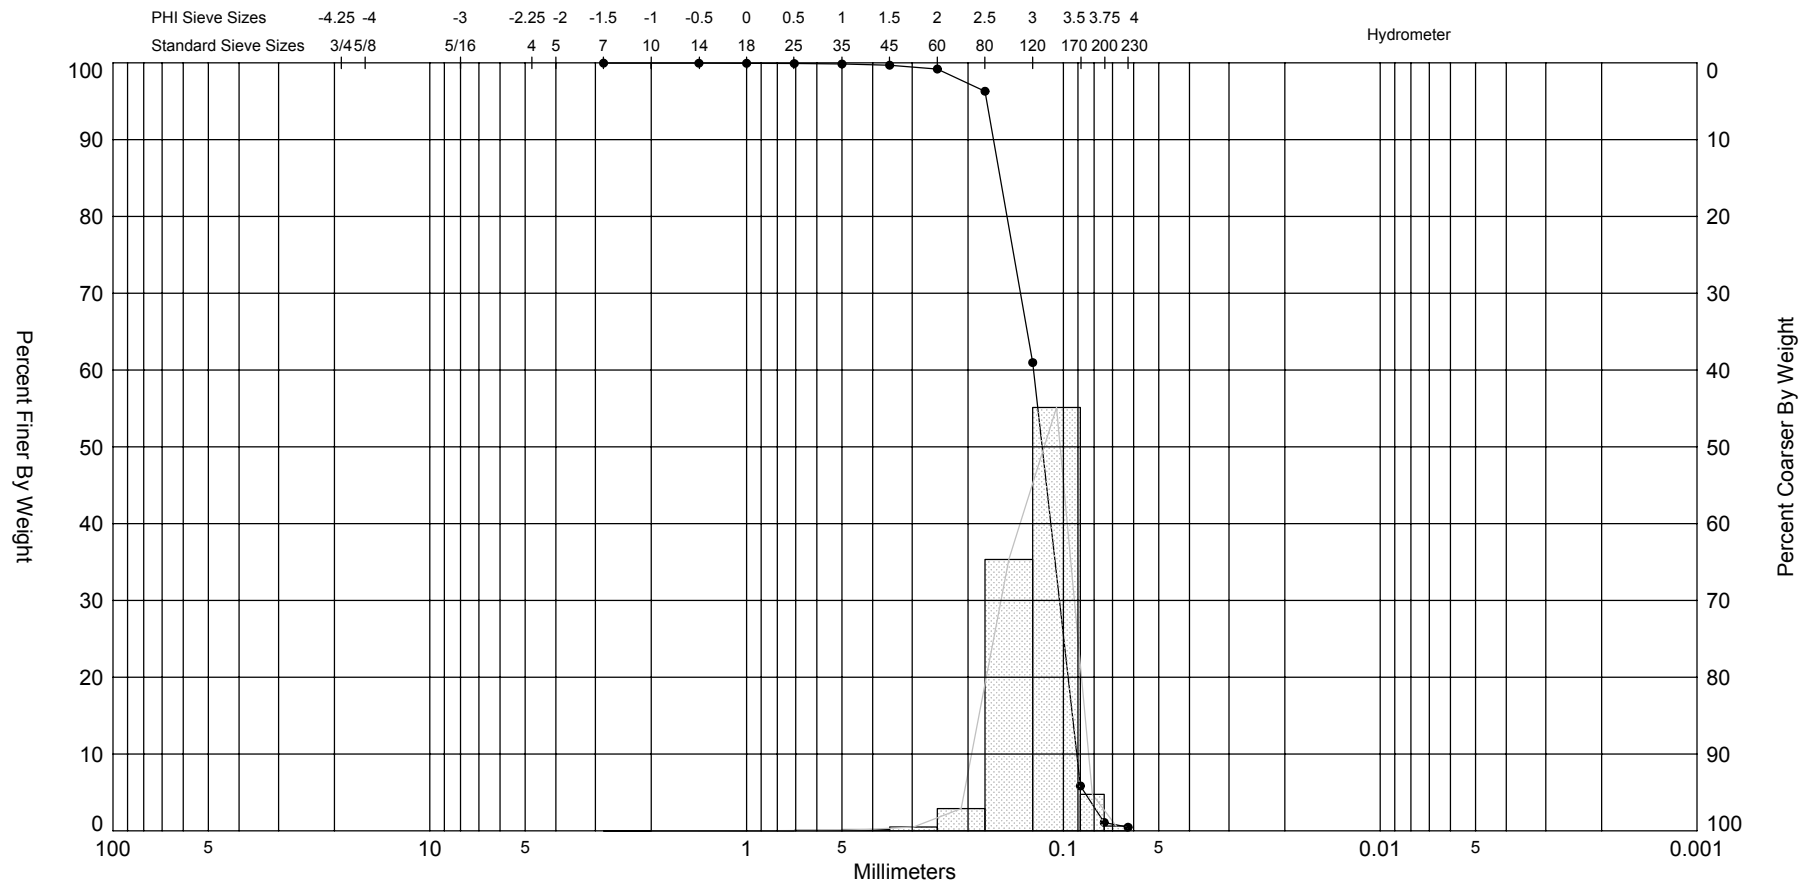

Gravel		Sand			Silt and Clay	
Coarse	Fine	Coarse	Medium	Fine		


Sample	Symbol	Elev. (ft)	USCS	% Fines	% Organics	% Carbonates	Median	Mean	Skew	Kurt	Sort	Sample Information	
SI-05-77 #3.0	—●—	-46.8	SP	#200 - 1.09 #230 - 0.47		19.43	3.1	3.05	-1.35	10.1	0.34	Project Name:	Singer Island 2005
Comments:												Analysis Date:	09-03-05
Depths and elevations based on measured values												Analyzed By:	SEA Inc.
						Scientific Environmental Applications 5575 Willoughby Drive Melbourne, FL 32934 ph 321 254-2708 fax 321 254-2708						Easting (X, ft):	973,688
												Northing (Y, ft):	905,367
												Horizontal System:	NAD 1983
												Vertical System:	NGVD 29

SIEVE ANALYSIS: SINGER ISLAND.GPJ FL DEP ROSS.GDT 9/23/05

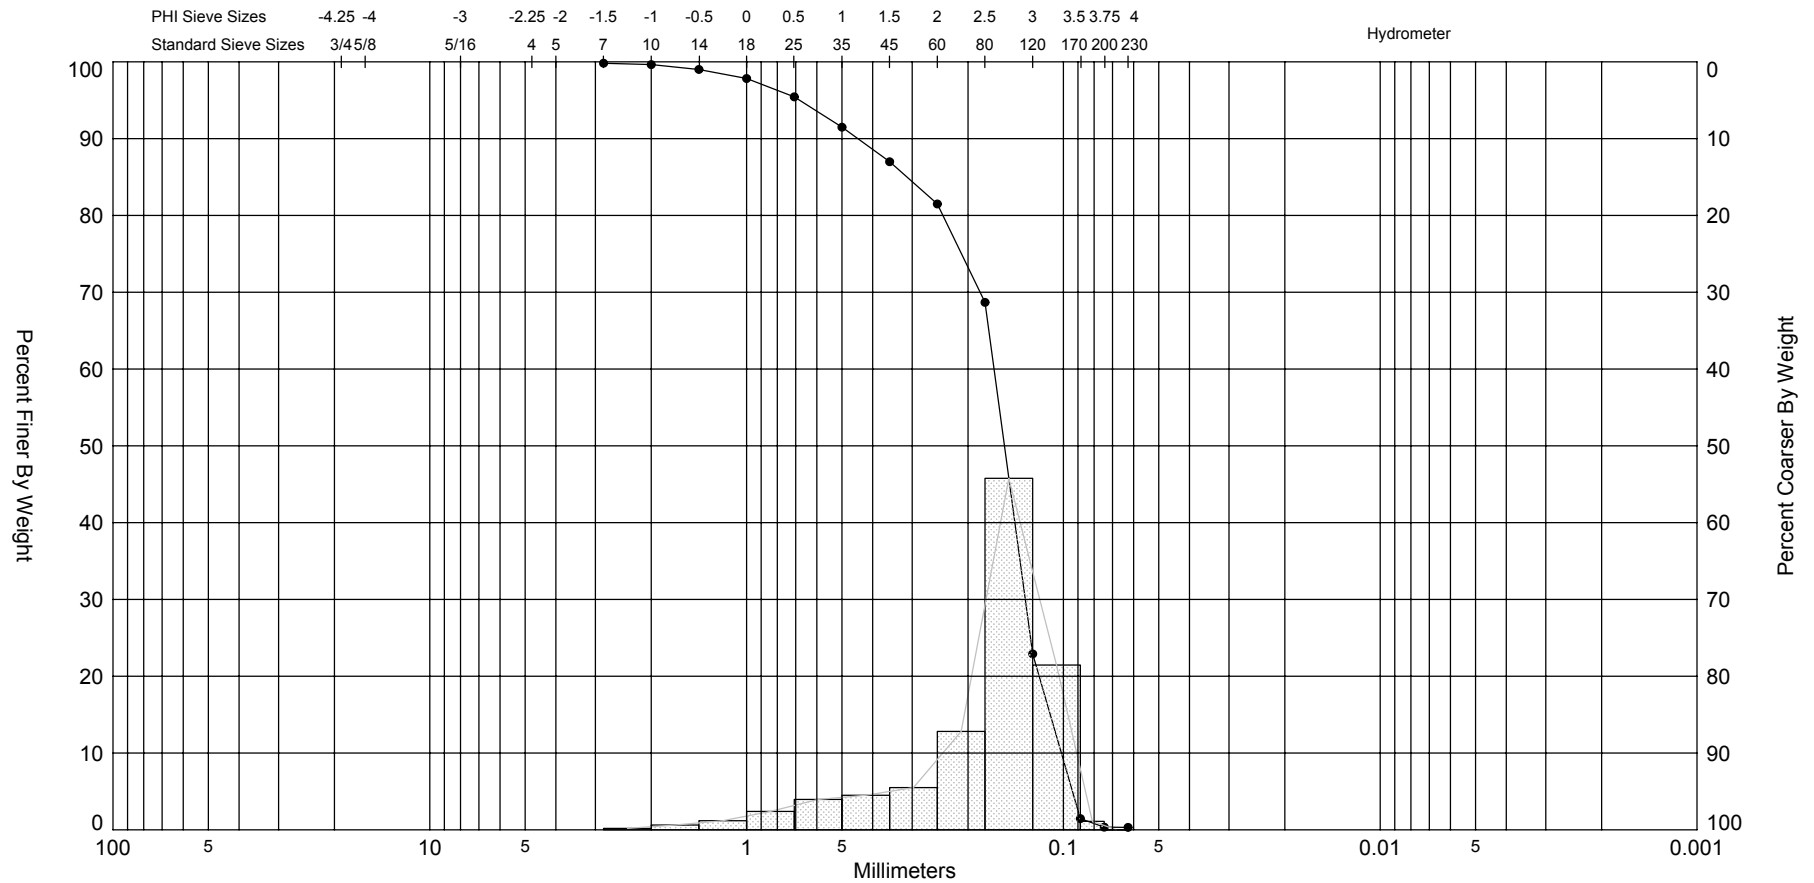

Sample	Symbol	Elev. (ft)	USCS	% Fines	% Organics	% Carbonates	Median	Mean	Skew	Kurt	Sort	Sample Information	
SI-05-77 #6.0	—●—	-49.8	SP	#200 - 0.35 #230 - 0.32		38.01	2.7	2.47	-1.68	5.79	0.84	Project Name:	Singer Island 2005
Comments:												Analysis Date:	09-06-05
Depths and elevations based on measured values												Analyzed By:	SEA Inc.
						Scientific Environmental Applications 5575 Willoughby Drive Melbourne, FL 32934 ph 321 254-2708 fax 321 254-2708						Easting (X, ft):	973,688
												Northing (Y, ft):	905,367
												Horizontal System:	NAD 1983
												Vertical System:	NGVD 29


SIEVE ANALYSIS: SINGER ISLAND.GPJ FL DEP ROSS.GDT 9/23/05

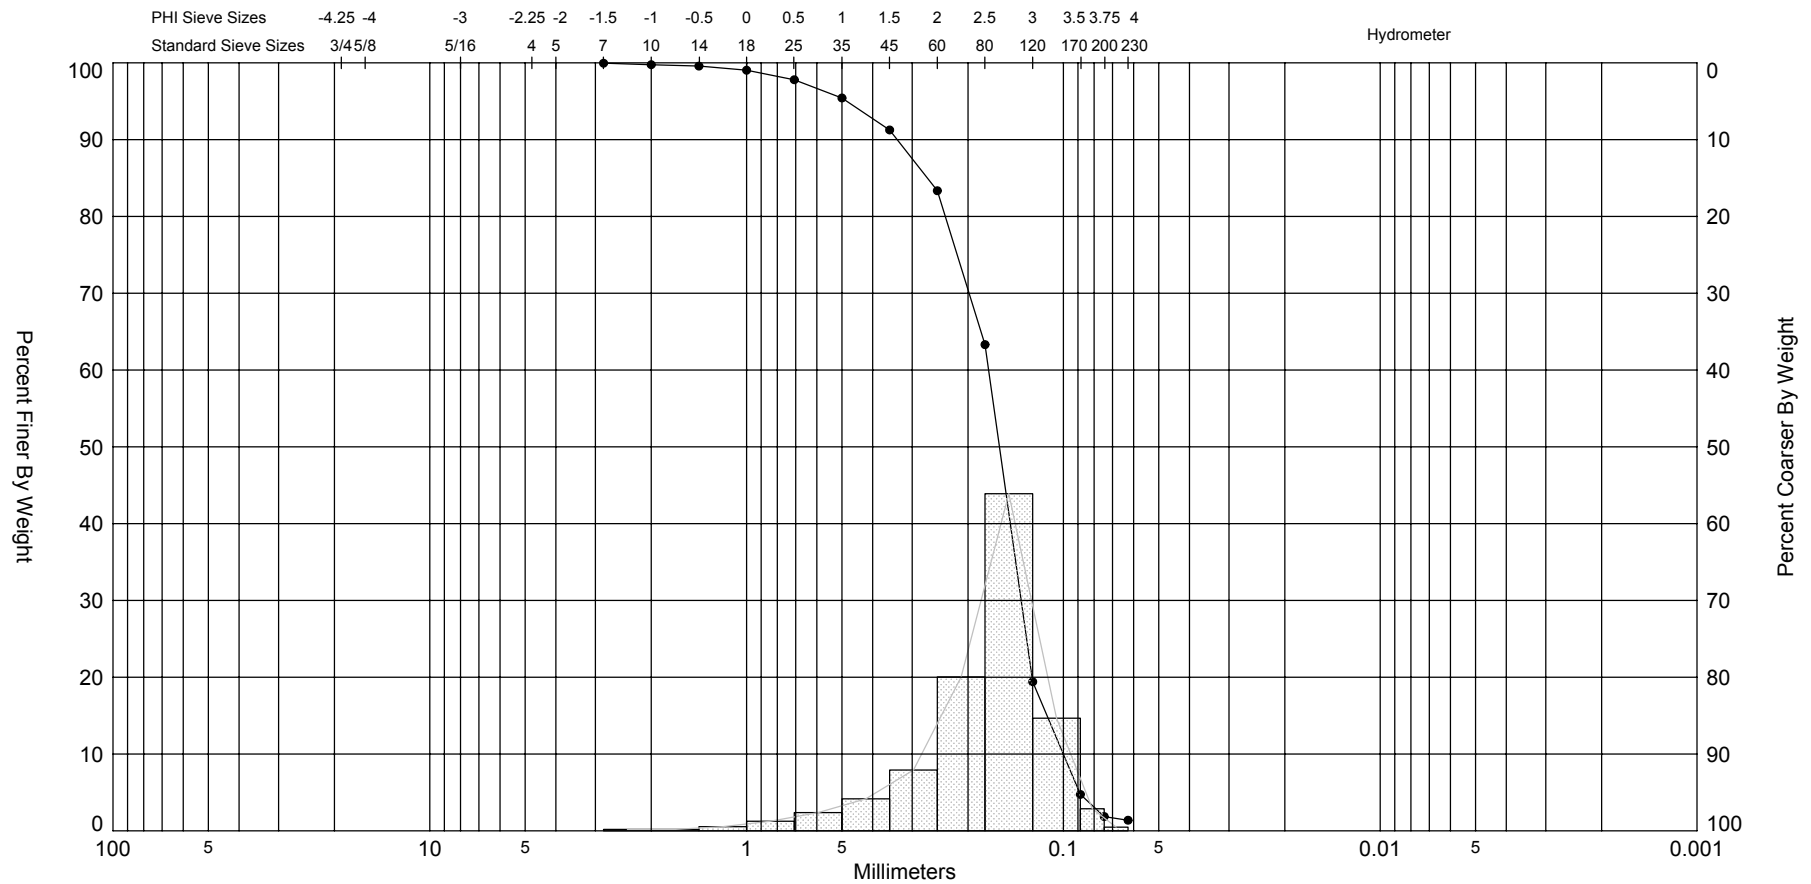

Gravel		Sand			Silt and Clay	
Coarse	Fine	Coarse	Medium	Fine		

Sample	Symbol	Elev. (ft)	USCS	% Fines	% Organics	% Carbonates	Median	Mean	Skew	Kurt	Sort	Sample Information	
SI-05-77 #9.0	—●—	-52.8	SP	#200 - 1.86 #230 - 1.38		43.41	2.65	2.5	-1.5	6.54	0.71	Project Name:	Singer Island 2005
Comments:												Analysis Date:	09-06-05
Depths and elevations based on measured values												Analyzed By:	SEA Inc.
						Scientific Environmental Applications 5575 Willoughby Drive Melbourne, FL 32934 ph 321 254-2708 fax 321 254-2708						Easting (X, ft):	973,688
												Northing (Y, ft):	905,367
												Horizontal System:	NAD 1983
												Vertical System:	NGVD 29

SIEVE ANALYSIS: SINGER ISLAND.GPJ FL DEP ROSS.GDT 9/23/05

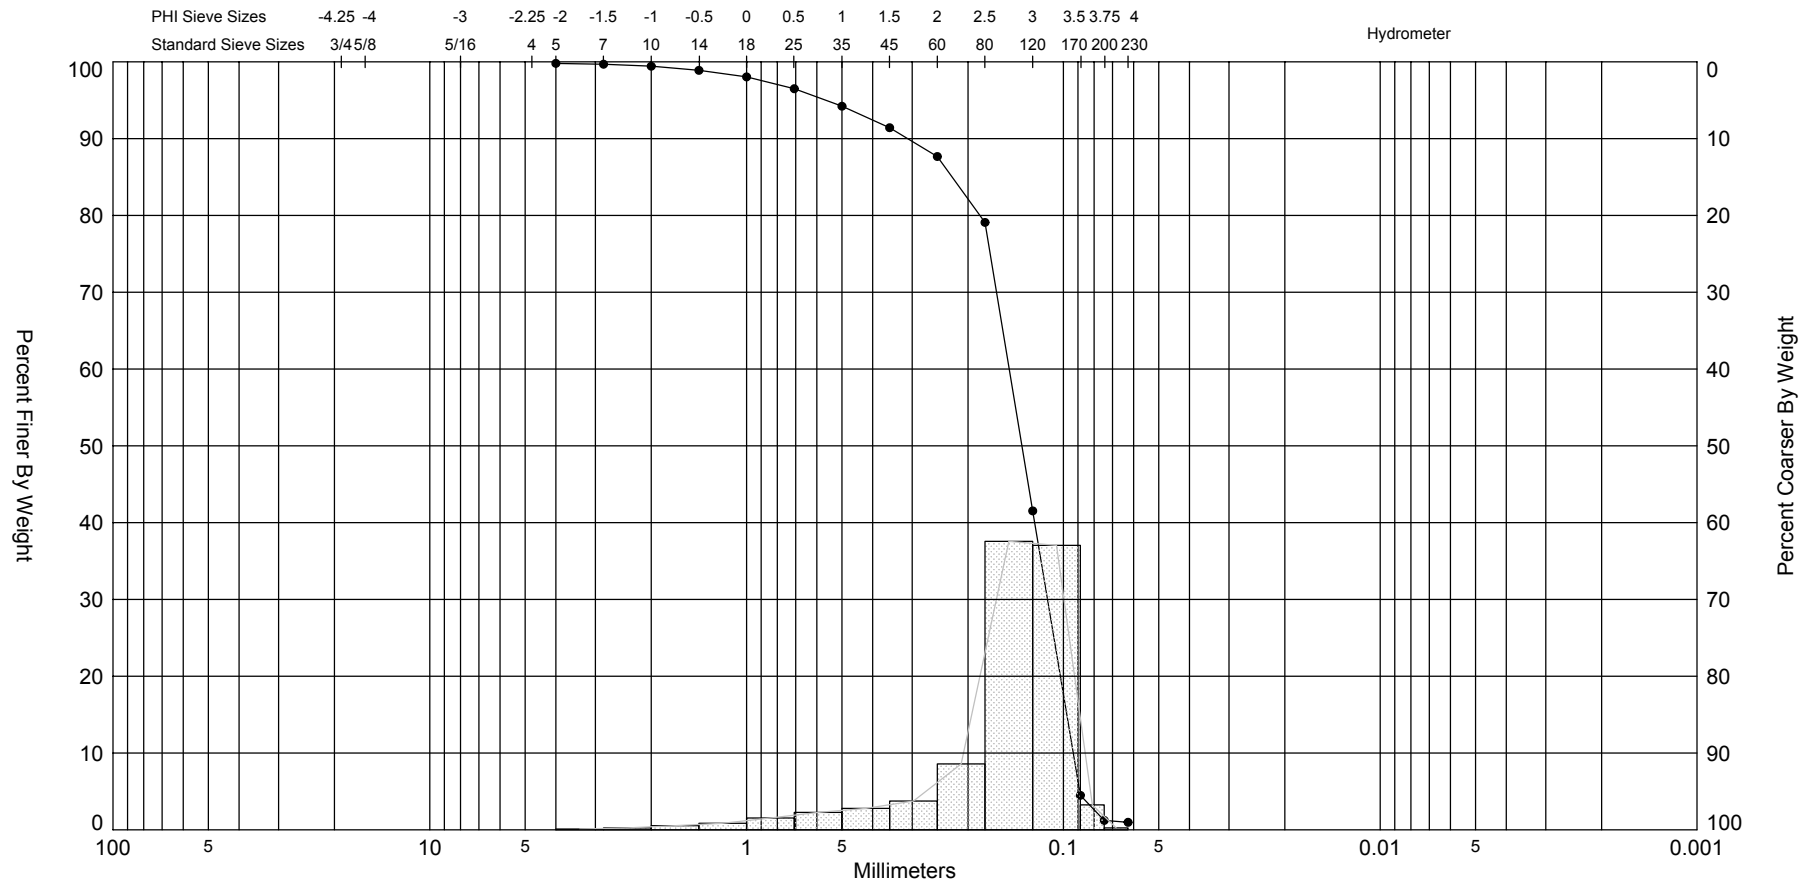

Gravel		Sand			Silt and Clay	
Coarse	Fine	Coarse	Medium	Fine		

Sample	Symbol	Elev. (ft)	USCS	% Fines	% Organics	% Carbonates	Median	Mean	Skew	Kurt	Sort	Sample Information	
SI-05-77 #Comp	—●—	-53.8	SP	#200 - 1.23 #230 - 0.98		33.01	2.89	2.69	-2.18	8.7	0.8	Project Name:	Singer Island 2005
Comments:												Analysis Date:	09-06-05
Depths and elevations based on measured values												Analyzed By:	SEA Inc.
						Scientific Environmental Applications 5575 Willoughby Drive Melbourne, FL 32934 ph 321 254-2708 fax 321 254-2708						Easting (X, ft):	973,688
												Northing (Y, ft):	905,367
												Horizontal System:	NAD 1983
												Vertical System:	NGVD 29