



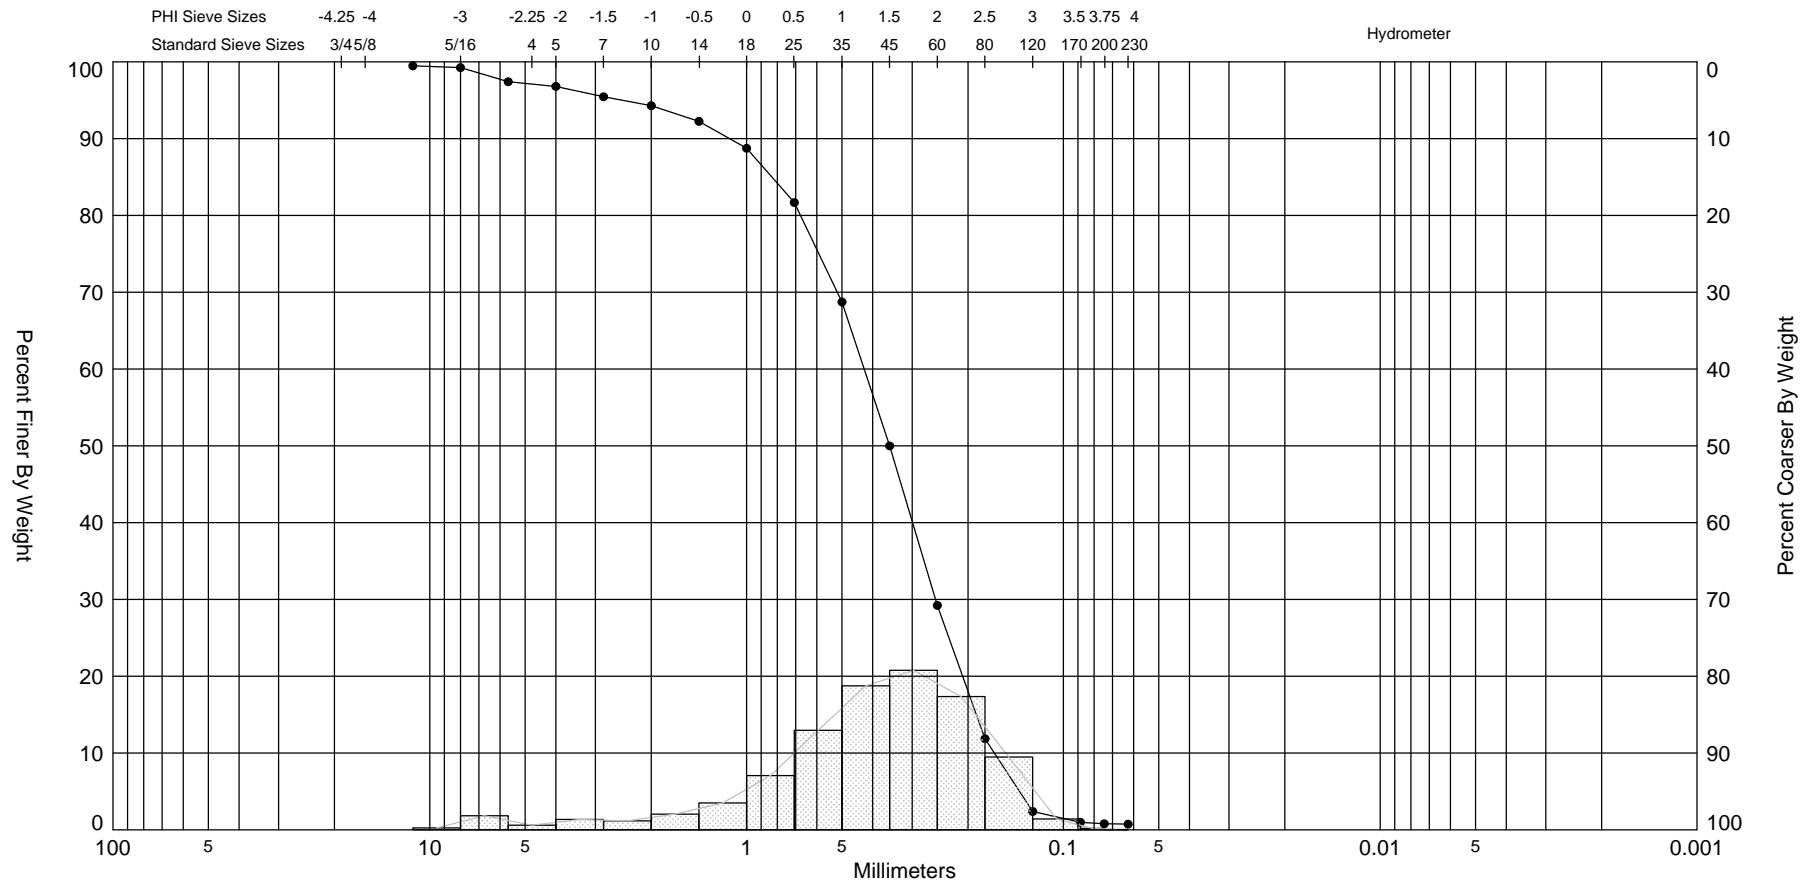
SIEVE ANALYSIS: SINGER_IS.GPJ FL DEP ROSS.GDT 4/28/08

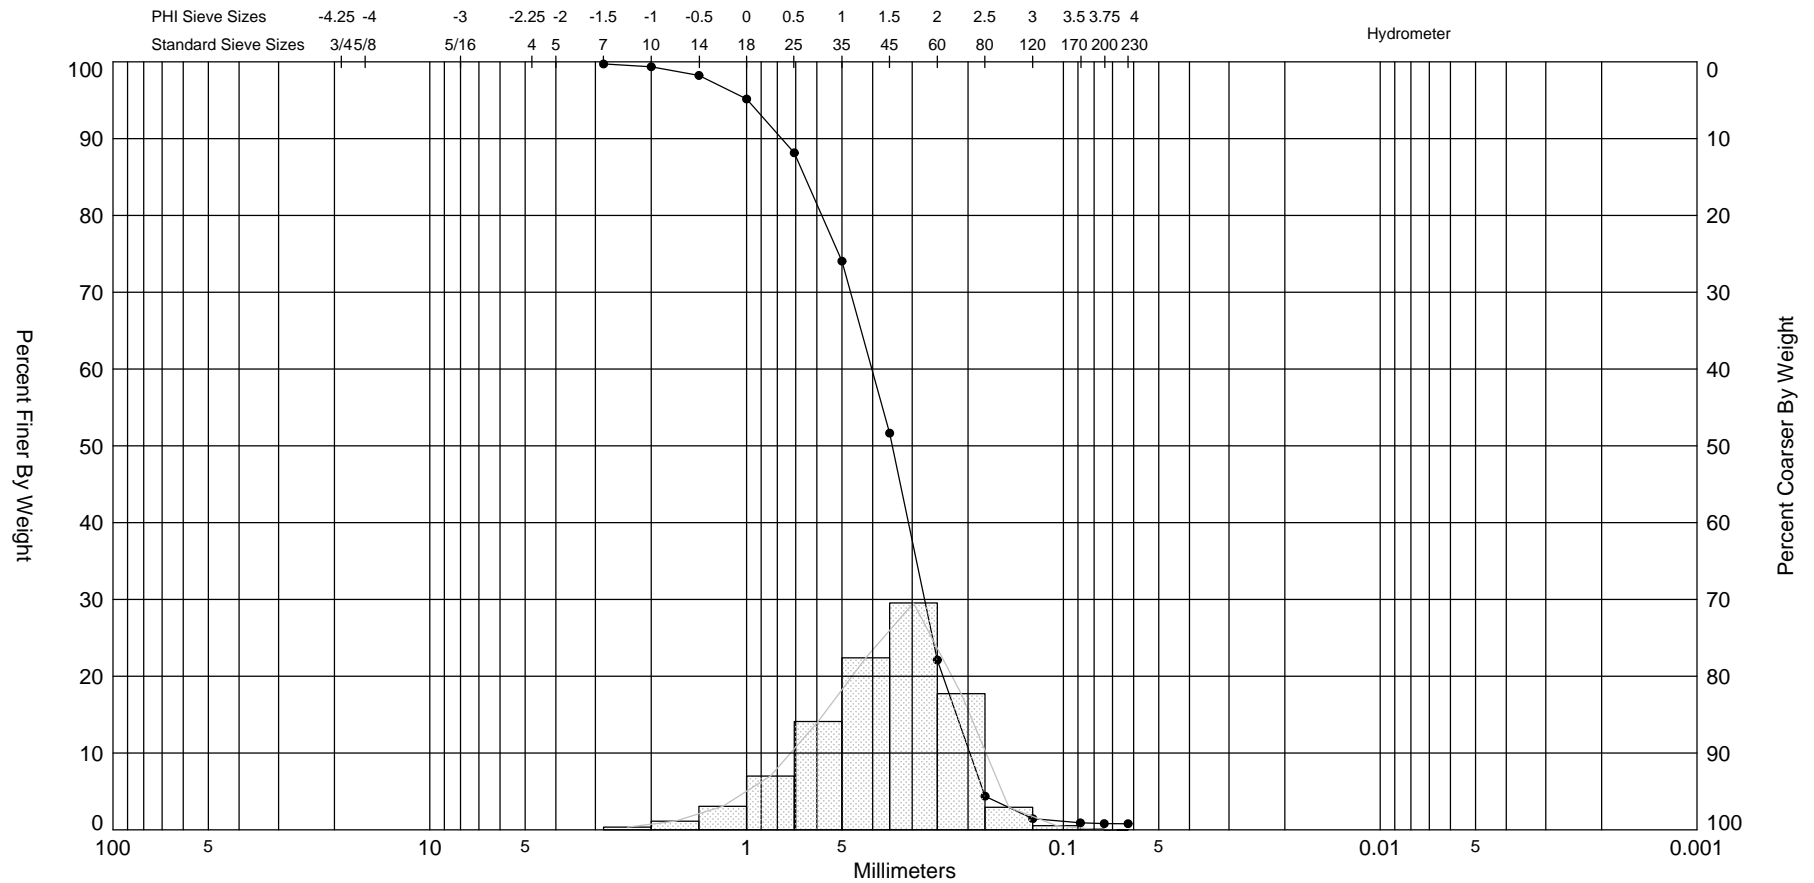

Gravel		Sand			Silt and Clay	
Coarse	Fine	Coarse	Medium	Fine		

Sample	Symbol	Elev. (ft)	USCS	% Fines	% Organics	% Carbonates	Median	Mean	Skew	Kurt	Sort	Sample Information	
SI04-6 #2.0		-69.6	SP	#200 - 0.81 #230 - 0.80		73.16	1.53	1.42	-0.59	3.46	0.75	Project Name:	Palm Beach County Vibracore 2004
Comments:												Analysis Date:	07-01-04
Depths and elevations based on measured values												Analyzed By:	SEA Inc.
						Scientific Environmental Applications 5575 Willoughby Drive Melbourne, FL 32934 ph 321 254-2708 fax 321 254-2708						Easting (ft):	975,132
												Northing (ft):	905,151
												Horizontal System:	NAD 1983
												Vertical System:	NAVD 88


SIEVE ANALYSIS: SINGER_IS.GPJ FL DEP ROSS.GDT 4/28/08



Gravel		Sand			Silt and Clay	
Coarse	Fine	Coarse	Medium	Fine		

Sample	Symbol	Elev. (ft)	USCS	% Fines	% Organics	% Carbonates	Median	Mean	Skew	Kurt	Sort	Sample Information	
SI04-6 #7.0	—●—	-74.6	SW	#200 - 0.75 #230 - 0.74		80.82	1.5	1.3	-1.29	5.23	1.18	Project Name:	Palm Beach County Vibracore 2004
Comments:												Analysis Date:	07-01-04
Depths and elevations based on measured values												Analyzed By:	SEA Inc.
						Scientific Environmental Applications 5575 Willoughby Drive Melbourne, FL 32934 ph 321 254-2708 fax 321 254-2708						Easting (ft):	975,132
												Northing (ft):	905,151
												Horizontal System:	NAD 1983
												Vertical System:	NAVD 88


SIEVE ANALYSIS: SINGER_IS.GPJ FL DEP ROSS.GDT 4/28/08

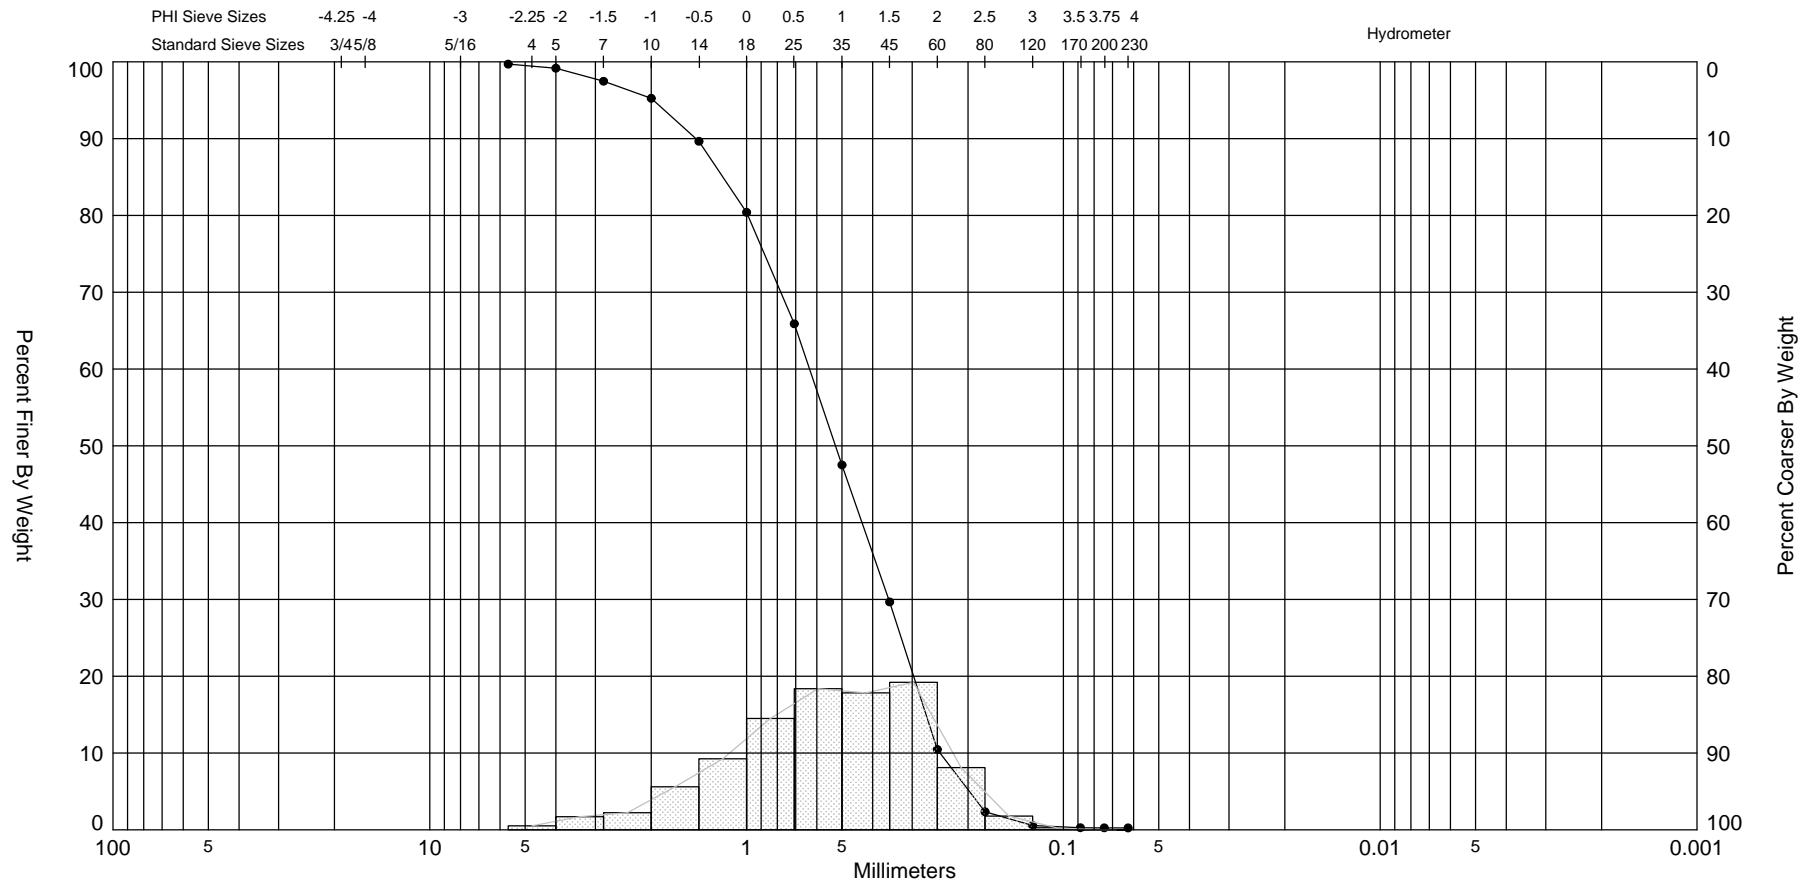


Gravel		Sand			Silt and Clay	
Coarse	Fine	Coarse	Medium	Fine		

Sample	Symbol	Elev. (ft)	USCS	% Fines	% Organics	% Carbonates	Median	Mean	Skew	Kurt	Sort	Sample Information	
SI04-6 #13.0	—●—	-80.6	SP	#200 - 0.26 #230 - 0.25		88.05	0.93	0.85	-0.49	2.98	1	Project Name:	Palm Beach County Vibracore 2004
Comments:												Analysis Date:	07-01-04
Depths and elevations based on measured values												Analyzed By:	SEA Inc.
						Scientific Environmental Applications 5575 Willoughby Drive Melbourne, FL 32934 ph 321 254-2708 fax 321 254-2708						Easting (ft):	975,132
												Northing (ft):	905,151
												Horizontal System:	NAD 1983
												Vertical System:	NAVD 88


SIEVE ANALYSIS: SINGER_IS.GPJ FL DEP ROSS.GDT 4/28/08

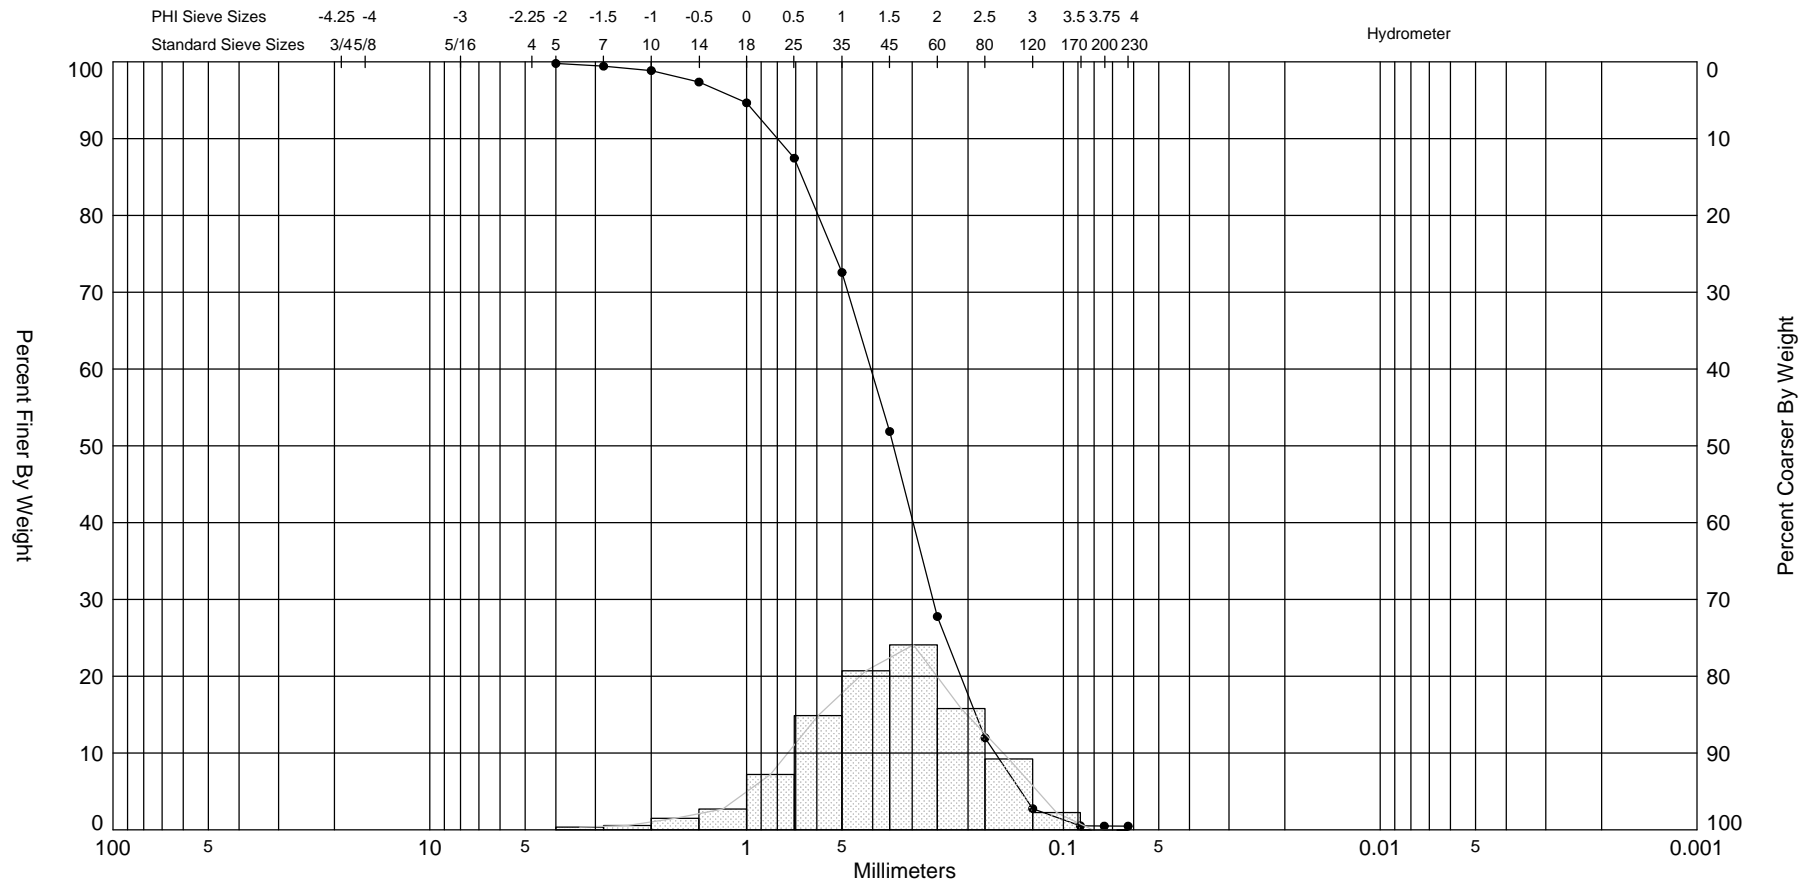


SIEVE ANALYSIS: SINGER_IS.GPJ FL DEP ROSS.GDT 4/28/08

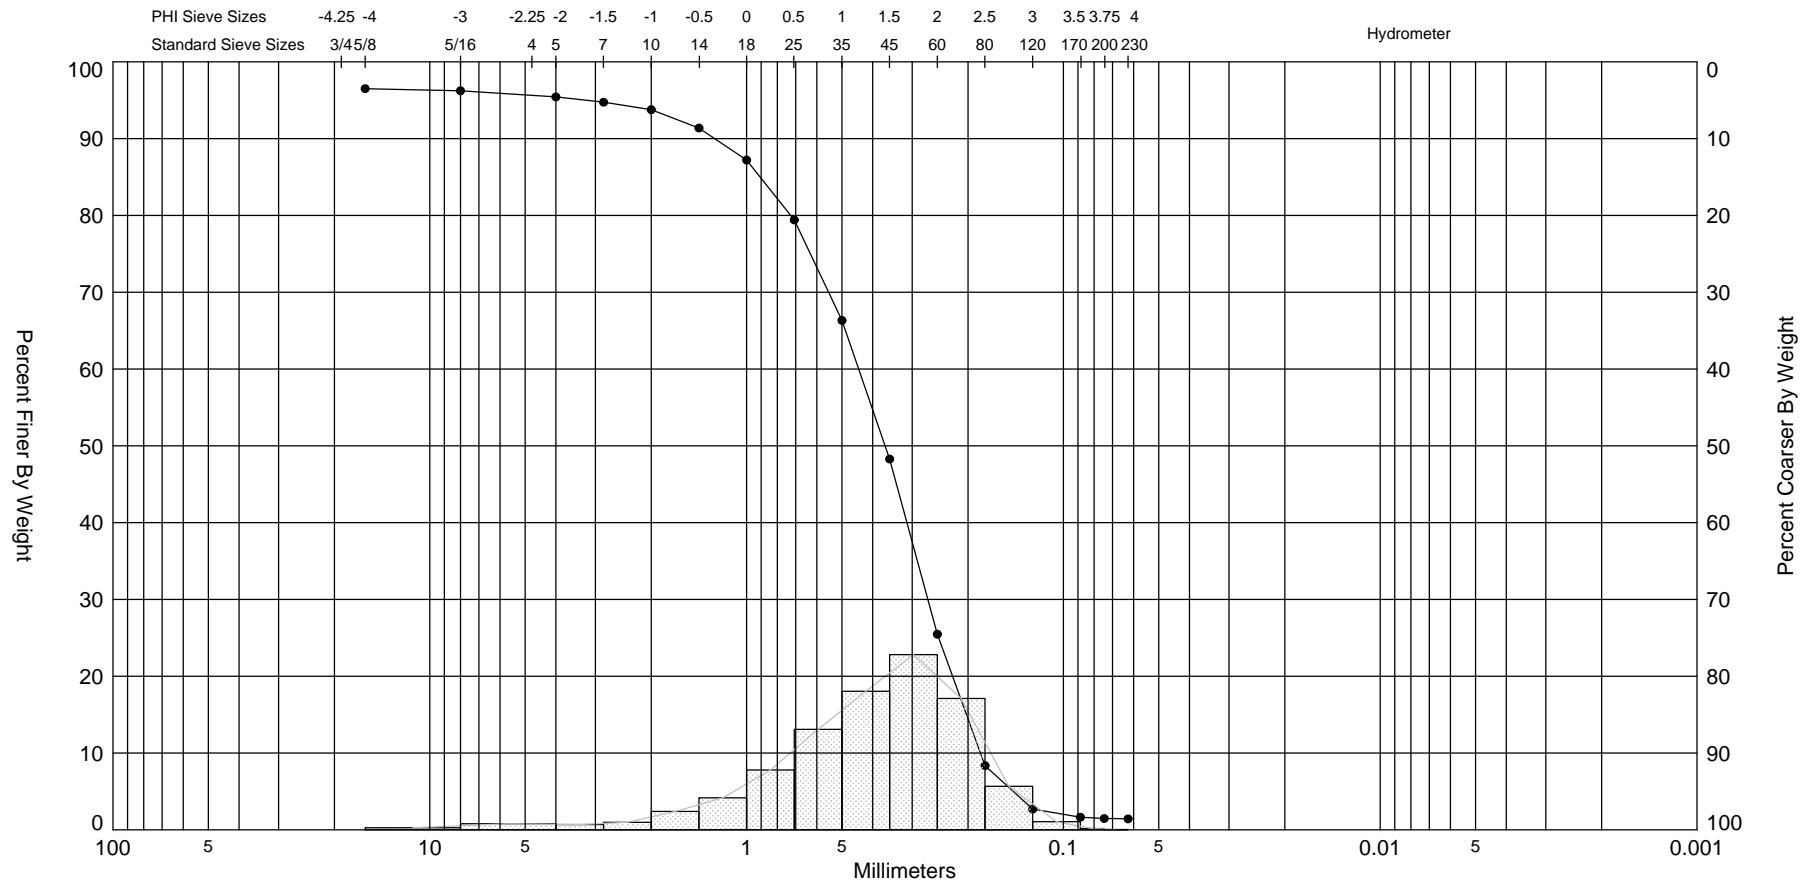

Gravel		Sand			Silt and Clay
Coarse	Fine	Coarse	Medium	Fine	

Sample	Symbol	Elev. (ft)	USCS	% Fines	% Organics	% Carbonates	Median	Mean	Skew	Kurt	Sort	Sample Information	
SI04-6 #Comp 1		-86.6	SP	#200 - 1.47 #230 - 1.43		77.43	1.45	1.31	-1.12	5.26	1.03	Project Name:	Palm Beach County Vibracore 2004
Comments:												Analysis Date:	07-01-04
Depths and elevations based on measured values												Analyzed By:	SEA Inc.
						Scientific Environmental Applications 5575 Willoughby Drive Melbourne, FL 32934 ph 321 254-2708 fax 321 254-2708						Easting (ft):	975,132
												Northing (ft):	905,151
												Horizontal System:	NAD 1983
												Vertical System:	NAVD 88

SIEVE ANALYSIS: SINGER_IS.GPJ FL DEP ROSS.GDT 4/28/08

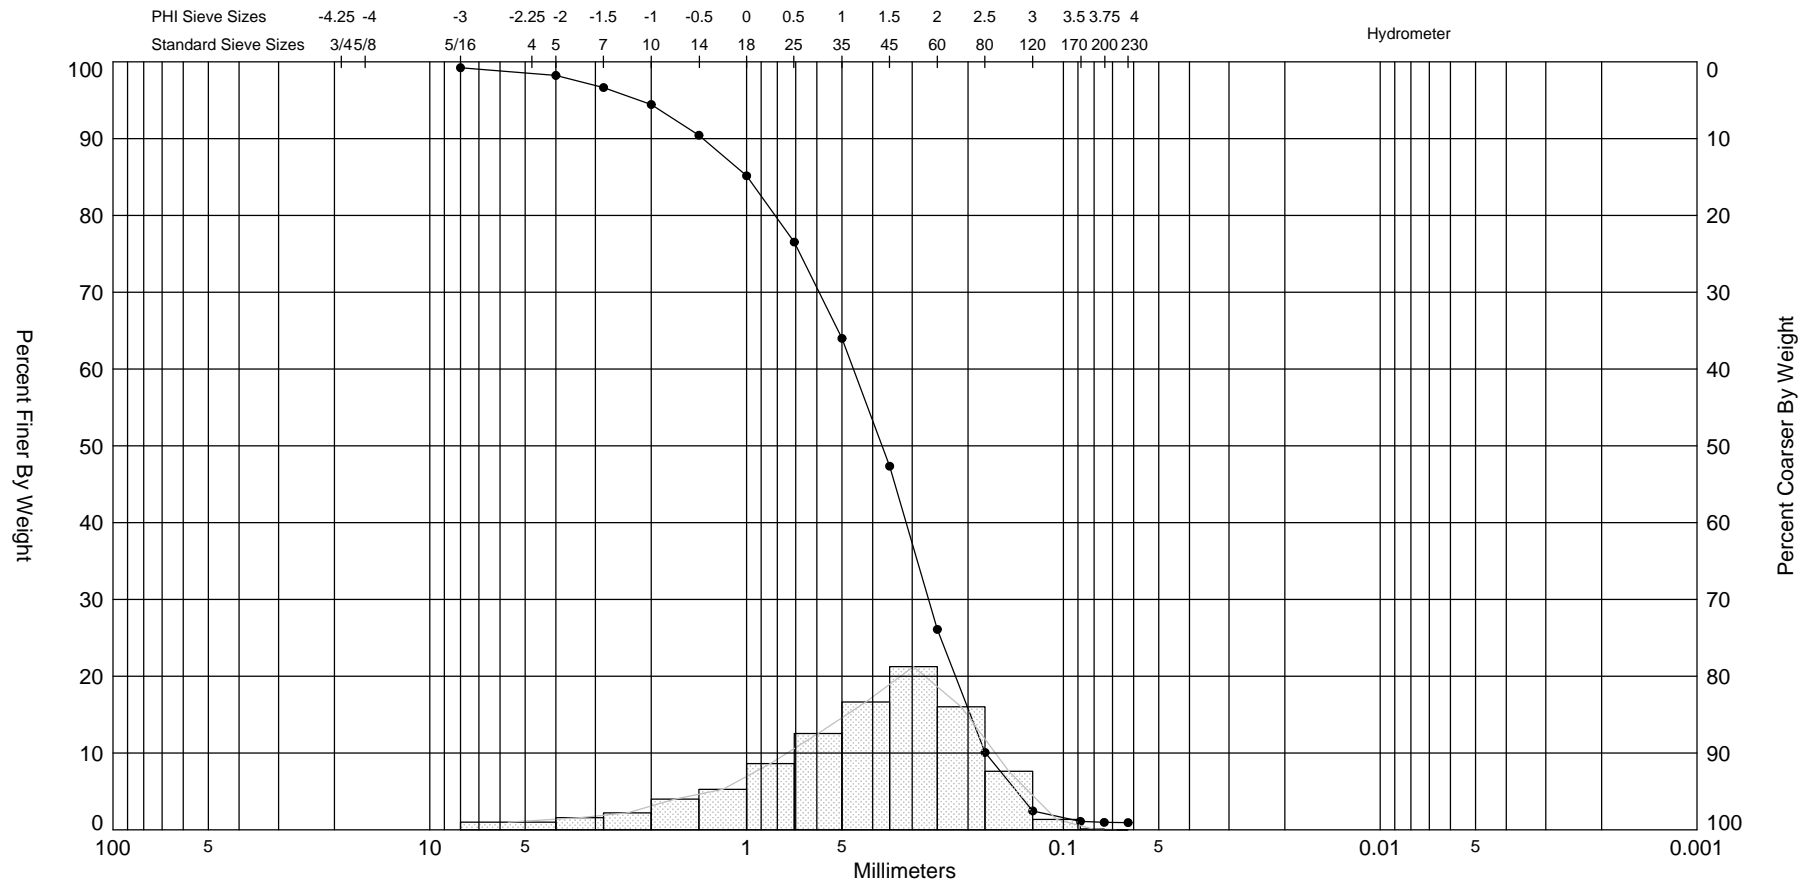

Gravel		Sand			Silt and Clay	
Coarse	Fine	Coarse	Medium	Fine		

Sample	Symbol	Elev. (ft)	USCS	% Fines	% Organics	% Carbonates	Median	Mean	Skew	Kurt	Sort	Sample Information	
SI04-6 #Comp 2	—●—	-87.6	SP	#200 - 0.97 #230 - 0.94		83.16	1.42	1.21	-0.83	3.55	1.13	Project Name:	Palm Beach County Vibracore 2004
Comments:												Analysis Date:	07-01-04
Depths and elevations based on measured values												Analyzed By:	SEA Inc.
						Scientific Environmental Applications 5575 Willoughby Drive Melbourne, FL 32934 ph 321 254-2708 fax 321 254-2708						Easting (ft):	975,132
												Northing (ft):	905,151
												Horizontal System:	NAD 1983
												Vertical System:	NAVD 88